

Digital Panel Meters 47NL Series
DC INPUT DIGITAL PANEL METER
(4 1/2 digit, LED display type, with terminal block)

Model: 47NLVT

OPERATING MANUAL

CONTENTS

1. INTRODUCTION	5
1.1 BEFORE USE.....	5
1.2 SAFETY PRECAUTIONS (that must be observed).....	6
1.3 POINTS OF CAUTION.....	8
1.4 COMPONENT IDENTIFICATION.....	10
1.5 INSTALLATION.....	13
1.5.1 EXTERNAL DIMENSIONS	13
1.5.2 PANEL CUTOUT DIMENSIONS	14
1.5.3 INSTALLATION	14
1.6 WIRING INSTRUCTIONS	18
1.6.1 CAUTION IN WIRING	18
1.6.2 RECOMMENDED SOLDERLESS TERMINAL	18
1.6.3 TERMINAL ASSIGNMENT.....	19
1.6.4 WIRING INPUT SIGNAL.....	19
1.6.5 WIRING ALARM OUTPUTS	20
1.6.6 WIRING POWER	21
1.6.7 ATTACHING/REMOVING TERMINAL COVER	21
2. BASIC SETTING AND OPERATION	22
2.1 BASIC SETTING	22
2.1.1 BASIC SETTING FLOW.....	22
2.1.2 RELATION BETWEEN INPUT SCALING AND DISPLAY SCALING	22
2.1.3 BASIC SETTING PROCEDURE.....	23
2.2 BASIC SETTING OPERATION AND INSTRUCTIONS	24
2.2.1 BASIC SETTING OPERATION.....	24
2.2.2 INSTRUCTIONS ON BASIC OPERATION.....	26
3. SETTING SCALING VALUES	27
3.1 STEP 1. INPUT SCALING ZERO.....	29
3.1.1 INPUT SCALING LIST	29
3.1.2 OPERATING PROCEDURE	30
3.2 STEP 2. DISPLAY SCALING ZERO	32
3.2.1 DISPLAY SCALING LIST.....	32
3.2.2 OPERATING PROCEDURE.....	33
3.3 STEP 3. INPUT SCALING SPAN.....	35
3.3.1 OPERATING PROCEDURE.....	35
3.4 STEP 4. DISPLAY SCALING SPAN.....	37
3.4.1 OPERATING PROCEDURE.....	37
3.5 STEP 5. DECIMAL POINT POSITION	39
3.5.1 DECIMAL POINT POSITION LIST.....	39
3.5.2 OPERATING PROCEDURE.....	40

4. OPERATION	42
5. PARAMETER CONFIGURATION.....	43
6. SETTING ALARM OUTPUT.....	48
6.1 ALARM POINT	51
6.1.1 OPERATING PROCEDURE	51
6.2 ALARM SETPOINT	52
6.2.1 ALARM SETPOINT LIST	52
6.2.2 OPERATING PROCEDURE.....	53
6.3 TRIP ACTION (LO/HI).....	55
6.3.1 OPERATING PROCEDURE.....	55
6.4 DEADBAND.....	57
6.4.1 OPERATING PROCEDURE.....	57
6.5 TRIP DELAY	59
6.5.1 OPERATING PROCEDURE.....	59
6.6 ALARM OUTPUT LOGIC (coil energized or de-energized at alarm).....	61
6.6.1 OPERATING PROCEDURE.....	61
6.7 MAIN DISPLAY BLINKING AT ALARM.....	63
6.7.1 OPERATING PROCEDURE.....	63
7. AVERAGING INPUT.....	65
7.1 OPERATING PROCEDURE.....	66
8. ELIMINATING FLUCTUATION AROUND “0”	67
8.1 LOW-END CUTOUT	68
8.1.1 OPERATING PROCEDURE	68
8.2 LOW-END CUTOUT VALUE.....	70
8.2.1 OPERATING PROCEDURE.....	70
9. ADJUSTING BRIGHTNESS OF DISPLAY.....	72
9.1 OPERATING PROCEDURE.....	73
10. GOING BACK AUTOMATICALLY TO MEASURING MODE	75
10.1 OPERATING PROCEDURE	76
11. ADJUSTING DISPLAY REFRESHING RATE.....	78
11.1 OPERATING PROCEDURE.....	79

12. USEFUL FUNCTIONS.....	81
12.1 CONFIRMING ALARM SETPOINTS.....	81
12.2 FORCING THE PRESENT DISPLAY VALUE TO ZERO	82
12.3 RETAINING MAX AND MIN VALUES	83
12.4 LIMITING BUTTON OPERATION.....	85
12.4.1 OPERATING PROCEDURE	85
12.5 TRANSITION TIME TO LOCKOUT SETTING MODE.....	87
12.5.1 OPERATING PROCEDURE	87
13. USER CALIBRATION.....	89
13.1 TEACH CALIBRATION	89
13.1.1 TEACH CALIBRATION FLOW.....	89
13.1.2 OPERATING PROCEDURE.....	90
14. INSPECTION / CLEANING	92
15. TROUBLESHOOTING	93
15.1 ERROR MESSAGES.....	93
15.2 INITIALIZING SETTING VALUES.....	93
15.2.1 OPERATING PROCEDURE	93
15.3 CONFIRMING FIRMWARE VERSION	95
15.3.1 OPERATING PROCEDURE	95
16. APPENDICES.....	96
16.1 SPECIFICATIONS	96
16.2 MODEL NUMBERING	98
16.3 PARAMETER LIST	99
16.4 PARAMETER MAP	102
16.4.1 OPERATION IN MEASURING MODE.....	102
16.4.2 SCALING SETTING MODE.....	103
16.4.3 ALARM SETTING MODE	104
16.4.4 ADVANCED SETTING MODE	105
16.4.5 LOCKOUT SETTING MODE	106
16.5 CHARACTER SET	107


1. INTRODUCTION

1.1 BEFORE USE....









Thank you for choosing us. Before use, please check contents of the package you received as outlined below.

■ PACKAGE INCLUDES

Digital panel meter

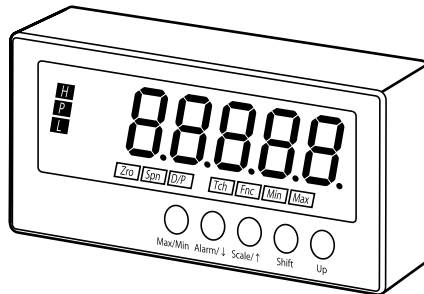

Accessories
 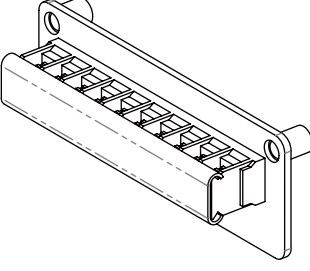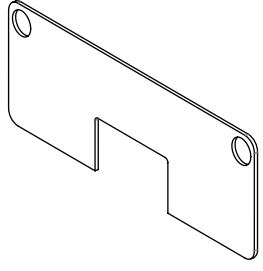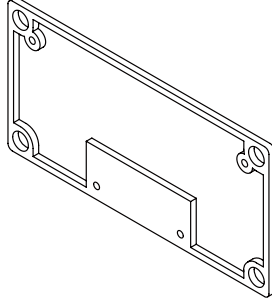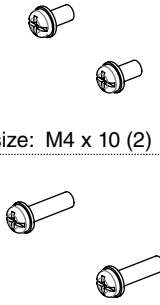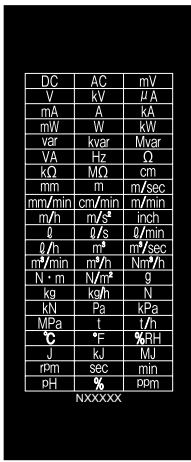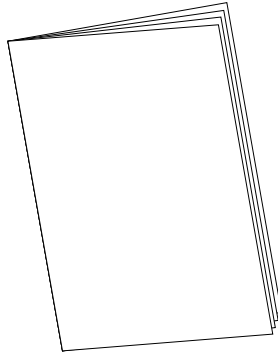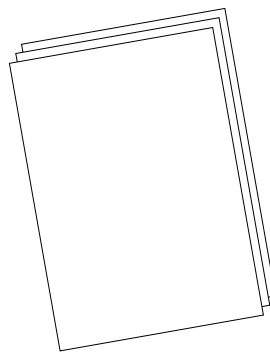
<p>Terminal block (1)</p> 	<p>Insulation sheet (1)</p> 	<p>Watertight packing (1)</p> 	<p>Unit fixing screw</p>  <p>screw size: M4 x 10 (2)</p>  <p>screw size: M4 x 20 (2)</p>																																																																	
<p>Engineering unit sticker label sheet (1)</p>  <table border="1" data-bbox="279 1344 438 1680"> <tr><td>DC</td><td>AC</td><td>mV</td></tr> <tr><td>V</td><td>kV</td><td>μA</td></tr> <tr><td>mA</td><td>A</td><td>kA</td></tr> <tr><td>mW</td><td>W</td><td>KW</td></tr> <tr><td>var</td><td>kvar</td><td>Mvar</td></tr> <tr><td>VA</td><td>Hz</td><td>Ω</td></tr> <tr><td>kΩ</td><td>MΩ</td><td>cm</td></tr> <tr><td>mm</td><td>m</td><td>m/sec</td></tr> <tr><td>mm/min</td><td>cm/min</td><td>m/min</td></tr> <tr><td>m/h</td><td>m/s</td><td>inch</td></tr> <tr><td>l</td><td>l/s</td><td>l/min</td></tr> <tr><td>l/h</td><td>m³</td><td>m³/sec</td></tr> <tr><td>m³/min</td><td>m³/h</td><td>Nm³/h</td></tr> <tr><td>N·m</td><td>N/m²</td><td>g</td></tr> <tr><td>kg</td><td>kg/h</td><td>N</td></tr> <tr><td>kN</td><td>Pa</td><td>kPa</td></tr> <tr><td>MPa</td><td>t</td><td>t/h</td></tr> <tr><td>°C</td><td>°F</td><td>%RH</td></tr> <tr><td>J</td><td>kJ</td><td>MJ</td></tr> <tr><td>rpm</td><td>sec</td><td>min</td></tr> <tr><td>pH</td><td>%</td><td>ppm</td></tr> <tr><td colspan="3">NXXXXX</td></tr> </table>	DC	AC	mV	V	kV	μA	mA	A	kA	mW	W	KW	var	kvar	Mvar	VA	Hz	Ω	kΩ	MΩ	cm	mm	m	m/sec	mm/min	cm/min	m/min	m/h	m/s	inch	l	l/s	l/min	l/h	m ³	m ³ /sec	m ³ /min	m ³ /h	Nm ³ /h	N·m	N/m ²	g	kg	kg/h	N	kN	Pa	kPa	MPa	t	t/h	°C	°F	%RH	J	kJ	MJ	rpm	sec	min	pH	%	ppm	NXXXXX			<p>Instruction manual</p> 	<p>Ordering Information Sheet</p>  <p>(included with the option code 'SET' only)</p>
DC	AC	mV																																																																		
V	kV	μA																																																																		
mA	A	kA																																																																		
mW	W	KW																																																																		
var	kvar	Mvar																																																																		
VA	Hz	Ω																																																																		
kΩ	MΩ	cm																																																																		
mm	m	m/sec																																																																		
mm/min	cm/min	m/min																																																																		
m/h	m/s	inch																																																																		
l	l/s	l/min																																																																		
l/h	m ³	m ³ /sec																																																																		
m ³ /min	m ³ /h	Nm ³ /h																																																																		
N·m	N/m ²	g																																																																		
kg	kg/h	N																																																																		
kN	Pa	kPa																																																																		
MPa	t	t/h																																																																		
°C	°F	%RH																																																																		
J	kJ	MJ																																																																		
rpm	sec	min																																																																		
pH	%	ppm																																																																		
NXXXXX																																																																				






■ MODEL NO.

Confirm Model No. marking on the product to be exactly what you ordered.

1.2 SAFETY PRECAUTIONS (that must be observed)

The following signs are used in this manual to provide precautions required to ensure safe usage of the unit. Please understand these signs and graphic symbols, read the manual carefully and observe the description.

The following signs show seriousness of safety hazard or damage occurred when used wrongly with the signs ignored.

 WARNING	Indicates a potentially hazardous situation which, if not avoided, may result in serious injury or death.	
 CAUTION	Indicates a potentially hazardous situation which, if not avoided, may result in injury or in property damage.	
 Indicates prohibitions.	 Indicates mandatory cautions.	 Indicates cautions.

WARNING



CAUTION

For safety, make sure that wiring is performed by qualified personnel only.

- Failure to do so may result in a fire, electric shock or injury.



CAUTION
ELECTRIC SHOCK

Do not touch the terminals while the power is on.

- Doing so may result in electric shock.



MANDATORY
CAUTION

Check the connection diagram carefully before wire connection.

- Failure to do so may result in malfunction, a fire or electric shock.



MANDATORY
CAUTION

Provide safety measures outside of the unit to ensure safety in the whole system if an abnormality occurs due to malfunction of the unit or another external factor affecting the unit's operation.



PROHIBITION
TO BE WET

Do not splash water on the unit except for the front panel installed correctly.

- Doing so may result in a fire, electric shock or injury.



MANDATORY
CAUTION

Stop using the unit immediately if smokes, unusual smell or abnormal noises come(s) from it.

- Using the unit continuously may result in a fire or electric shock.



MANDATORY
CAUTION

Stop using the unit if it is dropped or damaged.

- Using the unit continuously may result in a fire or electric shock.



MANDATORY
CAUTION

Tighten the terminal screws with a specified torque.

- Excessive fastening may result in damage of the screws and loose screws may occasionally result in ignition.



PROHIBITION

Do not throw the unit into the fire.

- Doing so may result in rupture of the electronic component.
-

CAUTION



PROHIBITION
TO DISCOMPOSE

Never discompose or remodel the unit.

- Doing so may result in electric shock, malfunction or injury.



PROHIBITION

Do not connect or remove the unit while its power is on.

- Doing so may result in electric shock, malfunction or injury.



MANDATORY
CAUTION

Do not allow fine shavings or wire scraps to enter the unit in machining screws or wiring.

- Doing so may result in malfunction of the unit.



MANDATORY
CAUTION

Make sure to attach the terminal cover.

- Failure to do so may result in electric shock.



PROHIBITION

Do not press buttons with a pointed object.

- Doing so may result in malfunction of the unit.



PROHIBITION

Do not pull the wires connecting to the terminal block or the harness connecting to the body.

- Doing so may result in electric shock, damage of the unit or injury.



PROHIBITION

Do not use the unit in the atmosphere where combustible gas is present.

- Doing so may result in inflammation, ignition or smoke.
-

1.3 POINTS OF CAUTION

■ CONFORMITY WITH EU DIRECTIVES

- Our products conforming to the EU Directives conforms to the standards required based on the premise that they are built into various equipment, apparatus or control panels to use. Because the EMC performance depends on the configuration, wiring or arrangement of the equipment, apparatus and control panels you build, it is necessary for you to make such equipment, apparatus or control panels to conform finally to the CE Marking by yourselves.

CAUTION

This product conforms to the EMC Directive for electrical and electronic apparatus intended for use in industrial environments. If it is used in the residential environments, it may cause radio interference, and the user is requested to take appropriate measures.

■ ENVIRONMENT

Install the unit within the installation specifications.

- Indoors use.
- Environmental temperature must be within -10 to +55°C (14 to 131°F) with relative humidity within 10 to 90% RH without condensing.
- Provide sufficient space around the unit for heat dissipation.
- Mount the unit to a panel between 1.0 and 3.2 mm thick.
- Install the unit in a well-ventilated place in order to prevent internal temperature rise.
- Refer to “Clustered mounting” to install several units. In mounting the unit with other equipment side by side, provide sufficient space between them, according to the dimensions in the clustered mounting.
- Do not use the unit under the following environments:
 - Where the unit is exposed to direct sunlight, rain or wind. (The unit is not designed for outdoor use.)
 - Where condensation may occur due to extreme temperature changes.
 - Where corrosive or flammable gas is present.
 - Where heavy dust, iron powder or salt is present in the air.
 - Where organic solvent such like benzene, thinner, and alcohol, or strong alkaline materials such like ammonia and caustic soda may attach to the unit, or where such materials are present in the air.
 - Where the unit is subject to continuous vibration or physical impact.
 - Where there are high-voltage lines, high-voltage equipment, power lines, power equipment, equipment with transmission unit such like a ham radio equipment, or equipment generating large switching surges around the unit.

■ WIRING

- In order to prevent potential electric shock, wire the unit after turning off the power supply and making sure that the power is not supplied to the cable.
- Be sure to confirm the name and polarity of each terminal before wiring to the terminal block.
- Do not connect anything to unused terminals.
- Be sure to attach the terminal cover to prevent electric shock.

■ HANDLING CAUTIONS

- The unit is designed to function as soon as power is supplied, however, a warm up for 10 minutes is required for satisfying complete performance described in the data sheet.
- Use the unit within the noted supply power voltage and rated load.
- The last measured values are held in mode transition. Take this into consideration when configuring the control system.
- Clean the surface of the unit with wet soft cloth. Do not use organic solvent such like benzene, thinner and alcohol. Doing so may result in deformation or discoloration of the unit.
- When abnormality is found such like smokes, unusual smell and abnormal noises coming from the unit, immediately cut the power supply and stop using it.
- Do not remove the harness connecting to the body.
In case that it is removed, replace it according to the following pin No. Use a minus screwdriver with blade edge 0.4 mm (0.02”) and blade width 2 mm (0.08”) to connect the wires to the tension clamp terminal block on the body.


■ BODY

PIN No.	NAME	WIRE COLOR
1	Input (+)	White
2	Input (-)	Black
3	Input	Black
4	H alarm output	Black
5	L alarm output	Black
6	COM	Black
7	Power input (+)	Black
8	Power input (-)	Black

■ HARNESS

PIN No.	NAME	WIRE COLOR
1	Power input (+)	Black
2	Power input (-)	Black
3	----	----
4	COM	Black
5	L alarm output	Black
6	H alarm output	Black
7	----	----
8	----	----
9	Input	Black
10	Input (-)	Black
11	Input (+)	White

■ BODY

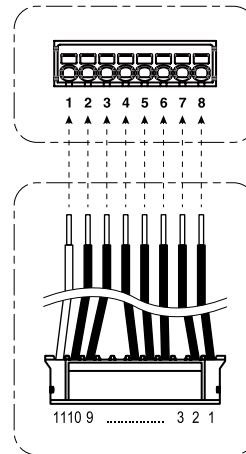

■ HARNESS

■ TO ENSURE DUSTPROOF AND WATERPROOF (degree of protection IP66)


To ensure dustproof and waterproof for front panel follow conditions below.

- Observe the designated panel cutout size (30.5 mm dia.) specified by us.
- The watertight packing included in the product package must be placed between the body and panel when installing on the panel.
- Fasten the body and panel together with four M4 screws (torque: 0.6 – 0.9 N·m).
- After installation, confirm that there are no following abnormalities.
 - The packing is contorted.
 - There are some spaces between front panel and panel.
 - The packing is run off the edge.
 - The packing is cut off.
 - There are foreign objects sticking.
- When replacement of the watertight packing is needed, consult us.

1.4 COMPONENT IDENTIFICATION

■ BODY

• Front view

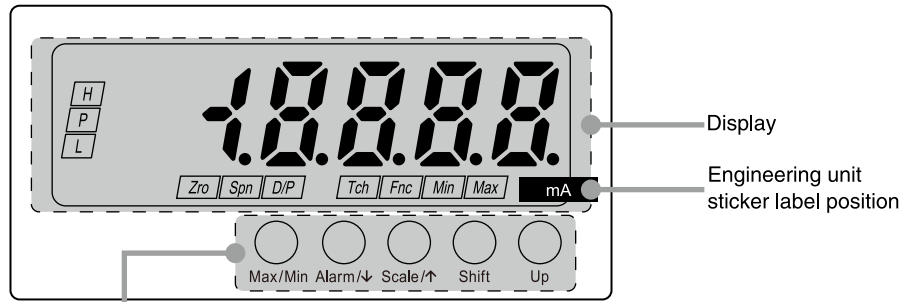


BUTTON	FUNCTION
Max/Min	Used to switch the main display to show the present value, MAX value or MIN value, and to reset the MAX and MIN values. Also used to cancel a set item.
Alarm/↓	Used to confirm the alarm setpoints, to move on to the alarm and other setting modes, or to shift through setting items in each setting mode.
Scale/↑	Used to move on to the scaling and other setting modes, or to shift through setting items in each setting mode.
Shift	Used to move on to the setting standby status of each setting mode and to shift through display digits in each setting item.
Up	Used to change setting values in a setting standby mode and to execute/cancel Forced Zero in Measuring Mode.

NOTE

- The engineering unit sticker label position is our recommended position.
- When an engineering unit is specified by the Ordering Information Sheet, the unit(s) will be shipped with the sticker label put on the above position.


• Display

COMPONENT	FUNCTION
Main display	Indicates present, MAX and MIN values, parameters, setting values and error codes.

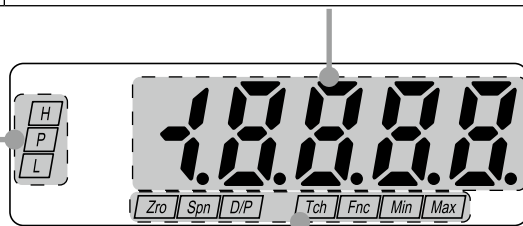

INDICATOR	MODE	FUNCTION	INDICATOR	MODE	FUNCTION
Alarm	Setting	Indicates parameters in Alarm Setting Mode. (Refer to 6. SETTING ALARM OUTPUT.)	Function	Setting	Indicates parameters in each mode. 'Zro', 'Spn', 'D/P', 'Tch' and 'Fnc' indicators turn on in combination depending on the parameters.
	Confirming alarm setpoints	'H' or 'L' indicator blinks in confirming each alarm setpoint. (Refer to 12.1 CONFIRMING ALARM SETPOINTS.)			Teach Calibration. 'Zro' or 'Spn' indicator turns on and 'Tch' indicator blinks. (Refer to 13.1 TEACH CALIBRATION.)
	Measuring	Indicates the comparison result between alarm setting values and present values. 'H' indicator turns on when the H alarm is tripped. 'L' indicator turns on when the L alarm is tripped. 'P' indicator turns on when none of the other alarms is tripped.			'Max' and 'Min' indicators blink when a parameter is within invalid range while setting.
			Measuring		Indicates Forced Zero mode. 'Zro' and 'Fnc' indicators turn on. (Refer to 12.2 FORCING THE PRESENT DISPLAY VALUE TO ZERO.)
					Indicates MAX or MIN value. 'Max' or 'Min' indicator turns on. (Refer to 12.3 RETAINING MAX AND MIN VALUES.)


• Top view

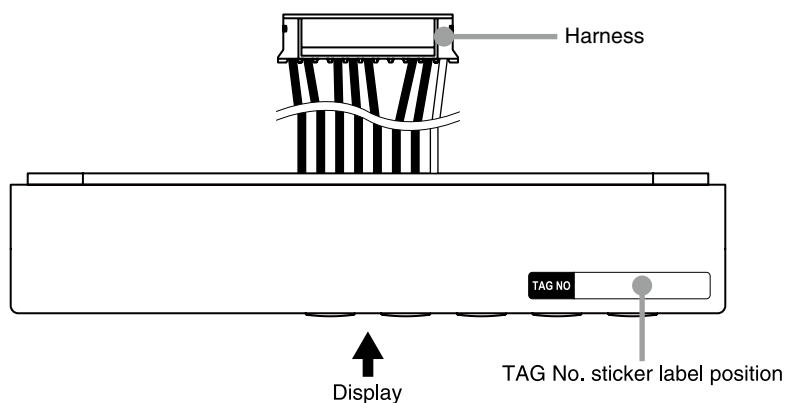

NOTE

- The tag No. label sticker position is our recommended position.
- When a tag No. is specified, the unit(s) will be shipped with the tag No. sticker labels put on the top of the body and the front of the terminal block. Max. 17 alphanumeric characters can be specified. Please consult us.

• Bottom view

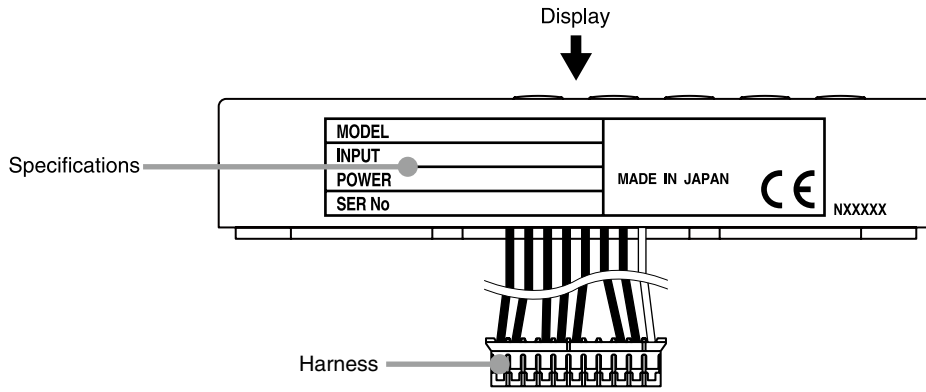


NOTE

Contents of the specification label depend on the specifications.

■ TERMINAL BLOCK


• Front view

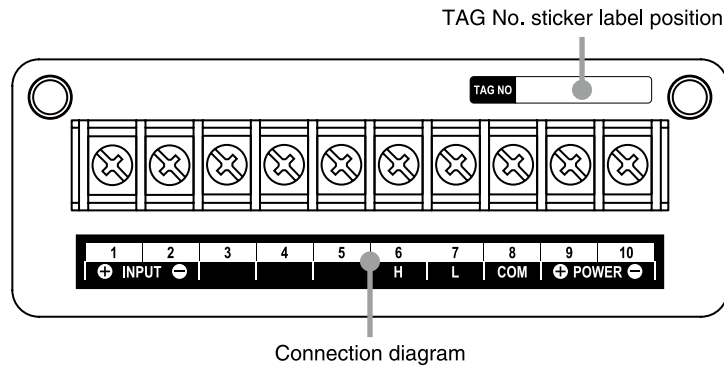

NOTE

The tag No. label sticker position is our recommended position.

• Rear view

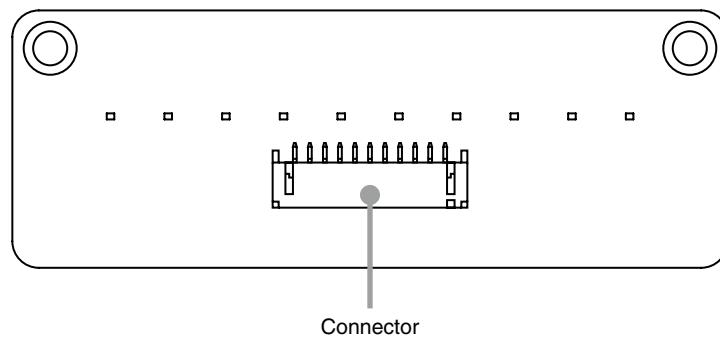


1.5 INSTALLATION

1.5.1 EXTERNAL DIMENSIONS


unit: mm (inch)

■ BODY


• FRONT VIEW

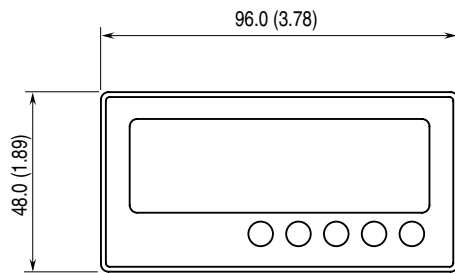

• SIDE VIEW

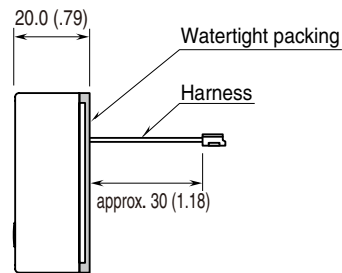


• REAR VIEW

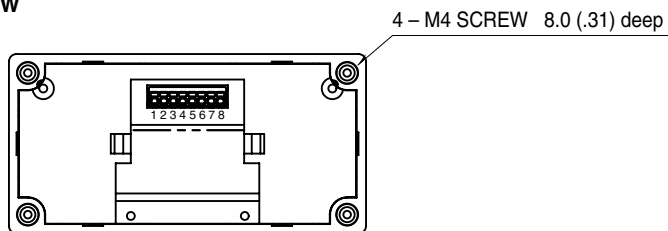


■ TERMINAL BLOCK


• FRONT VIEW

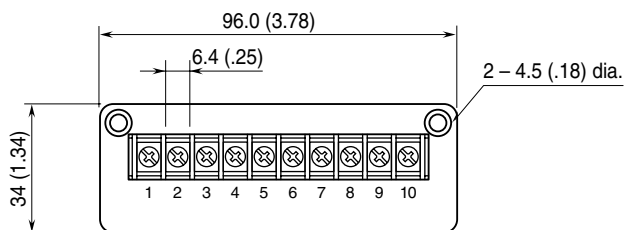

• REAR VIEW

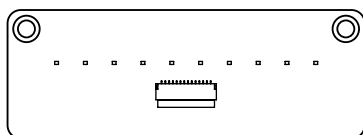


• SIDE VIEW

 


1.5.2 PANEL CUTOUT DIMENSIONS

Panel cutout must be such as specified by us.

• Single Mounting

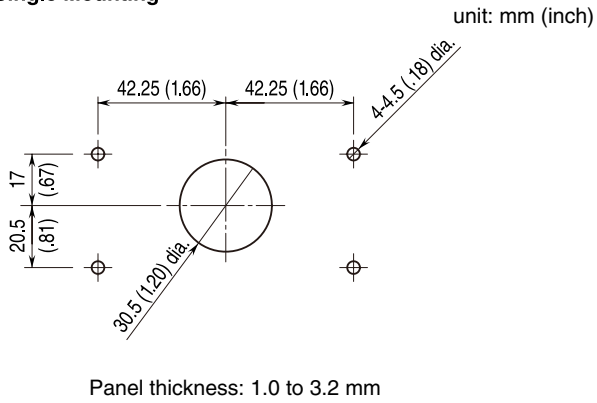

• Clustered Mounting

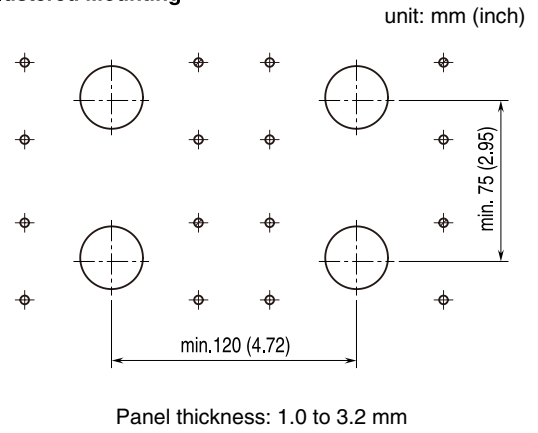

IMPORTANT


Remove burrs from the panel cut surface so that they may not damage the wires.

1.5.3 INSTALLATION

■ INSTALLATION

Fix the unit to the panel according to the following procedure. Step (3) and (4) may be exchanged.


(1) Mount the watertight packing to the body. Fit the concave part of the watertight packing in the convex part of the body.

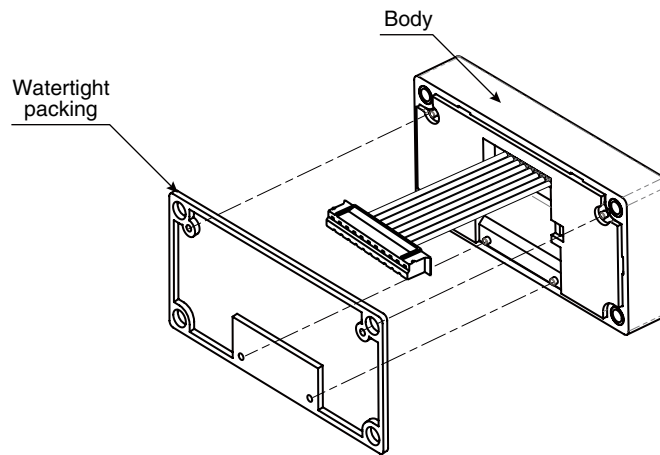


IMPORTANT

The watertight packing must be placed.

(2) Fasten the body and the panel together temporarily with two M4 × 10 screws at lower two points.

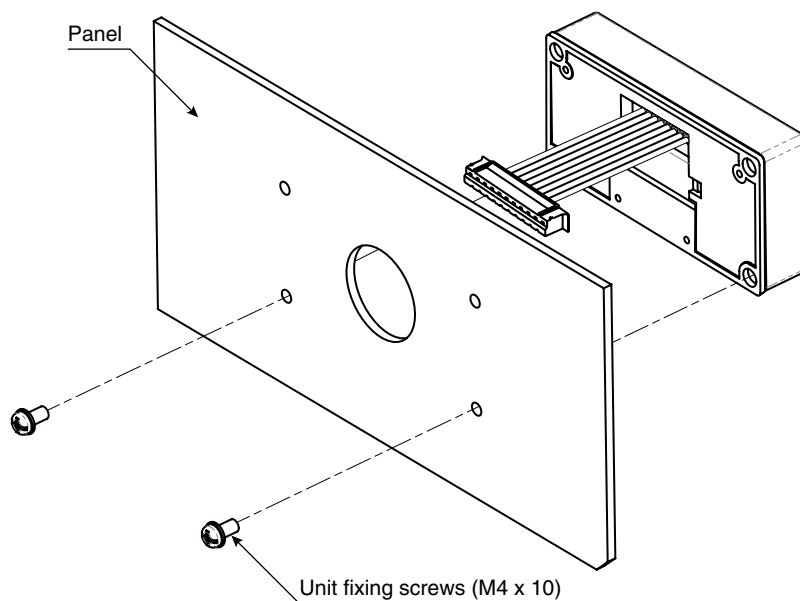


(3) Connect the harness of the body to the connector terminal block.

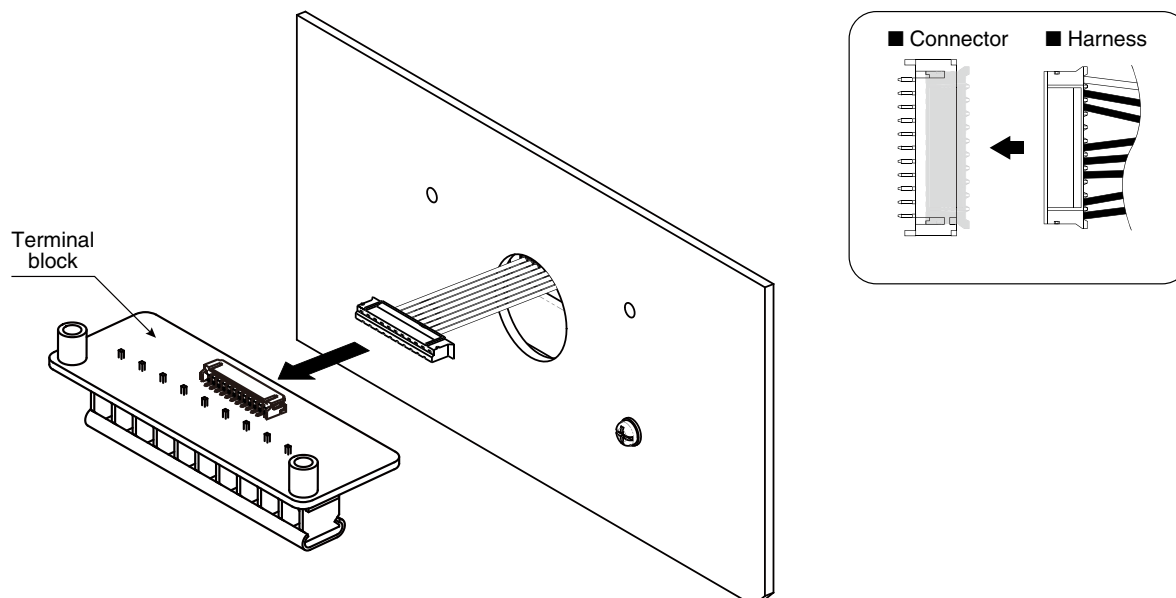

IMPORTANT

- Insert the harness deeply.
- Do not contort the harness wires.


- (4) Place the insulation sheet on the rear surface of the terminal block. Insert the spacers of the terminal block into the holes of the sheet.

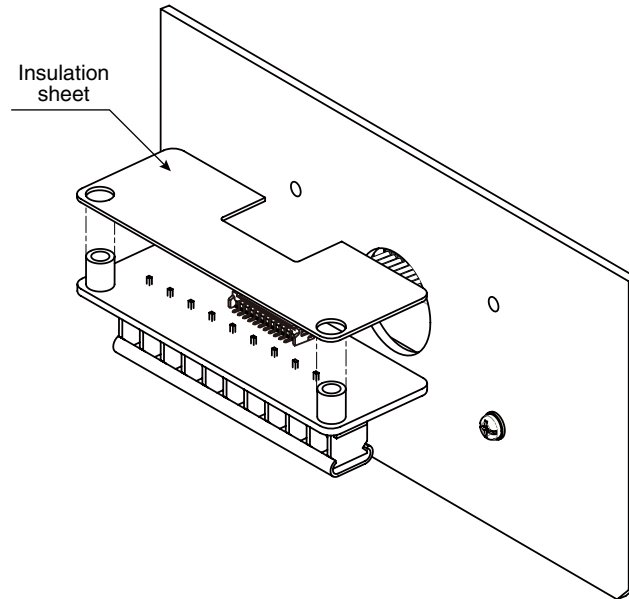

IMPORTANT

The insulation sheet must be placed in order to secure dielectric strength between the terminal block and the panel.

- (5) Fasten the terminal block, the panel, the watertight packing and the body together with two M4 × 20 screws at upper two points. Tighten the M4 × 10 screws at lower point additionally.
Torque: 0.6 – 0.9 N·m

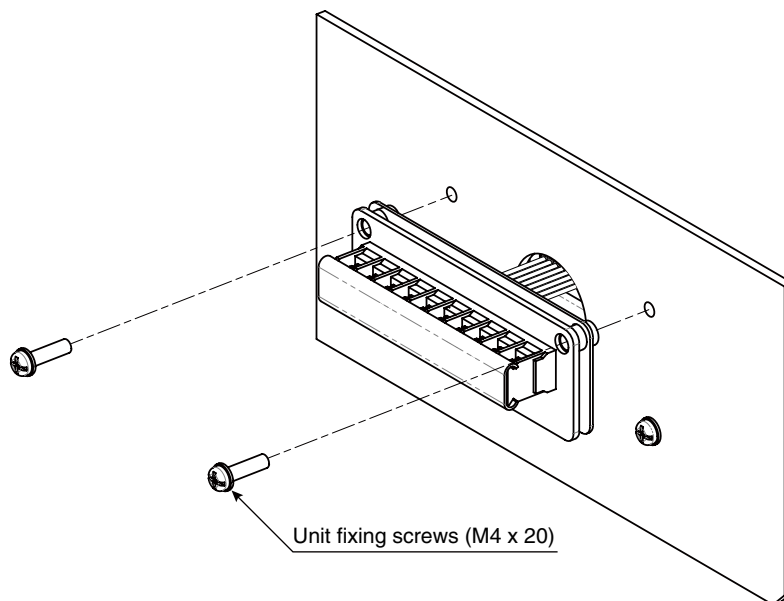

IMPORTANT

To conform to degree of protection IP66, confirm visually that the packing is not contorted, cut off or excessively run off the edge after installation.

■ REMOVAL

To remove the unit from the panel, perform the above procedure inversely.

Do not pull the wires to remove the harness. Grip the housing to remove in order to prevent disconnection of the wires.

1.6 WIRING INSTRUCTIONS


1.6.1 CAUTION IN WIRING

- For safety, make sure that wiring is performed by qualified personnel only.
- In order to prevent potential electric shock, wire the unit after turning off the power supply and making sure that the power is not supplied to the cable.
- Be sure to confirm the name and polarity of each terminal before wiring to it.
- Do not connect anything to unused terminals.
- We offer a series of lightning surge protectors for protection against induced lightning surges. Please contact us to choose appropriate models.

1.6.2 RECOMMENDED SOLDERLESS TERMINAL

- Use solderless terminals for M3. Refer to the drawings below.

unit: mm (inch)

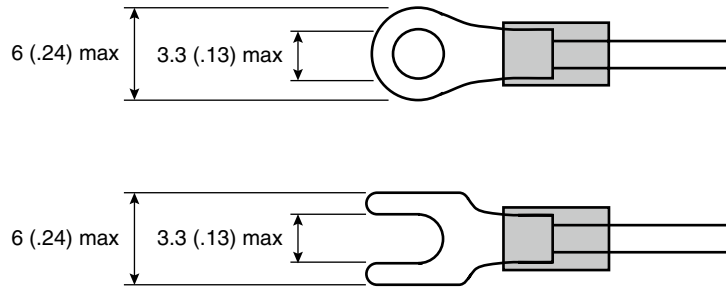

Applicable wire size: 0.25 to 1.65 mm²


Torque: 0.6 N·m

Recommended manufacturer: Japan Solderless Terminal MFG. Co., Ltd., Nichifu Co., Ltd.

IMPORTANT


- Insulated solderless terminals are recommended.
- In using non-insulated solderless terminals, cover them with insulating caps or tubes.
- Ring tongue terminals are recommended rather than spade tongue terminals to prevent from falling off.

1.6.3 TERMINAL ASSIGNMENT

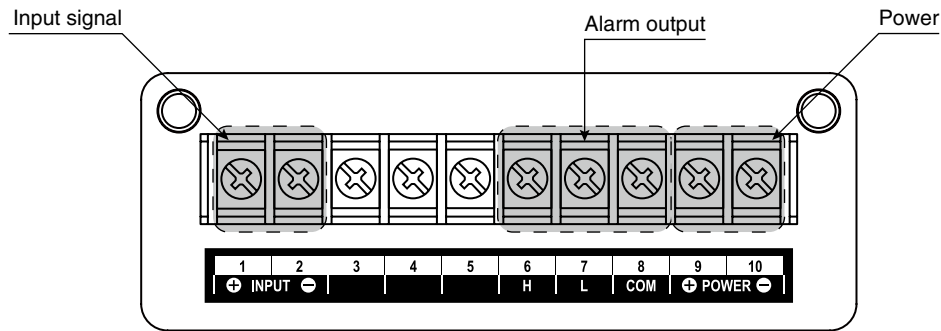

1.6.4 WIRING INPUT SIGNAL

Connect DC voltage or current signal wires.

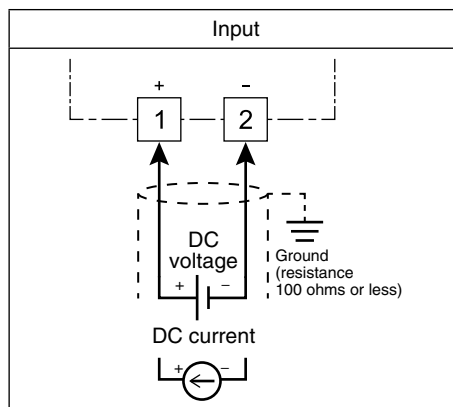


IMPORTANT

- Be sure to confirm the input polarity in wiring. Wrong connection may result in malfunction of the unit.
- In order to prevent potential electric shock, wire the unit after cutting the input signal and making sure that the power is not supplied to the cable.
- Take measures to reduce noise as much as possible, e.g. by using shielded twisted pair wires for the input signal. Ground the input shield to the most stable earth to prevent noise troubles.
- Do not connect anything to unused terminals.

1.6.5 WIRING ALARM OUTPUTS

Two alarm contacts are output.

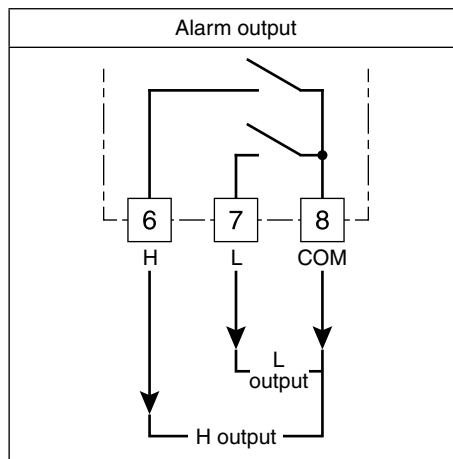


IMPORTANT

- Connect load within the specifications.
- With inductive load such like an external relay or a motor, insert a CR circuit, a diode or a varistor in parallel to protect the contacts and eliminate noise.

NOTE


Example of contact protection circuit with inductive load

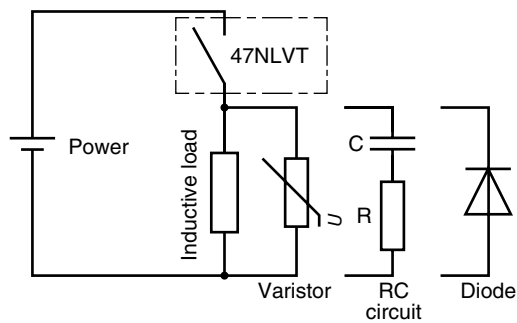

1.6.6 WIRING POWER

Connect DC power. DC power specifications are as shown in the following table.

CODE	RATING	PERMISSIBLE RANGE
R	24 V DC	±10% 0.7 W or less

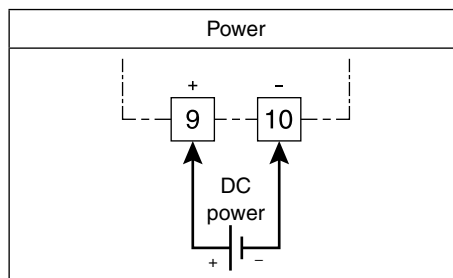


IMPORTANT

- For safety, make sure that wiring is performed by qualified personnel only.
- In order to prevent potential electric shock, wire the unit after turning off the power supply and making sure that the power is not supplied to the cable.
- Be sure to confirm the polarity in wiring.

1.6.7 ATTACHING/REMOVING TERMINAL COVER

Attach the terminal cover for safety after wiring.

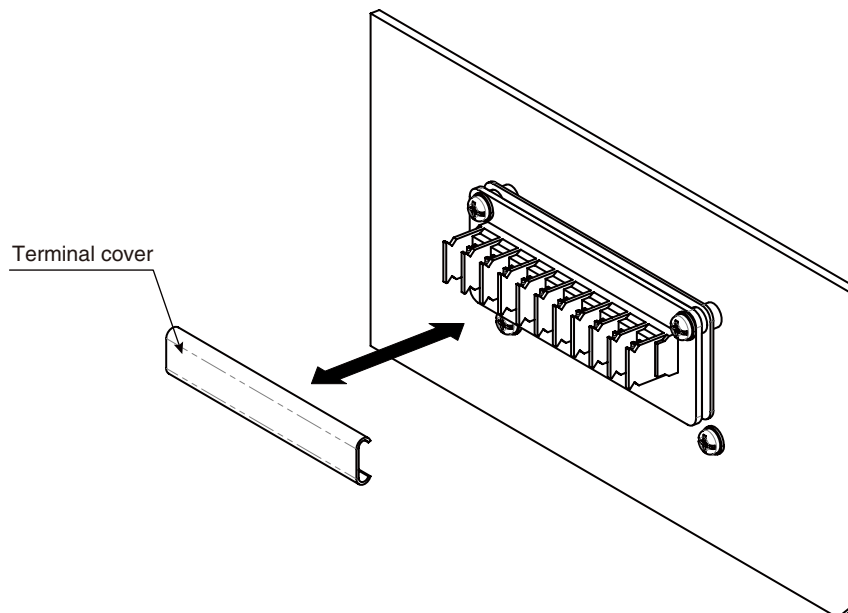

2. BASIC SETTING AND OPERATION


2.1 BASIC SETTING

This section describes flow and procedure of the basic setting.

The following shows the flow and procedure to set the input to 0 – 7 V DC and the display to 0.00 – 70.00 m/s with the input code '4' as an example.


2.1.1 BASIC SETTING FLOW

The basic setting is as shown in the following flowchart.

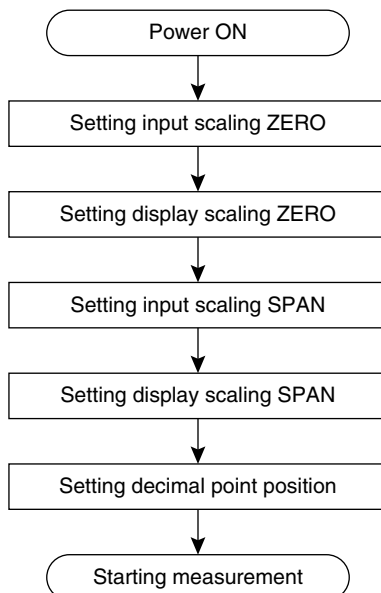

2.1.2 RELATION BETWEEN INPUT SCALING AND DISPLAY SCALING

The relation between input scaling and display scaling is as shown in the following figure and chart.

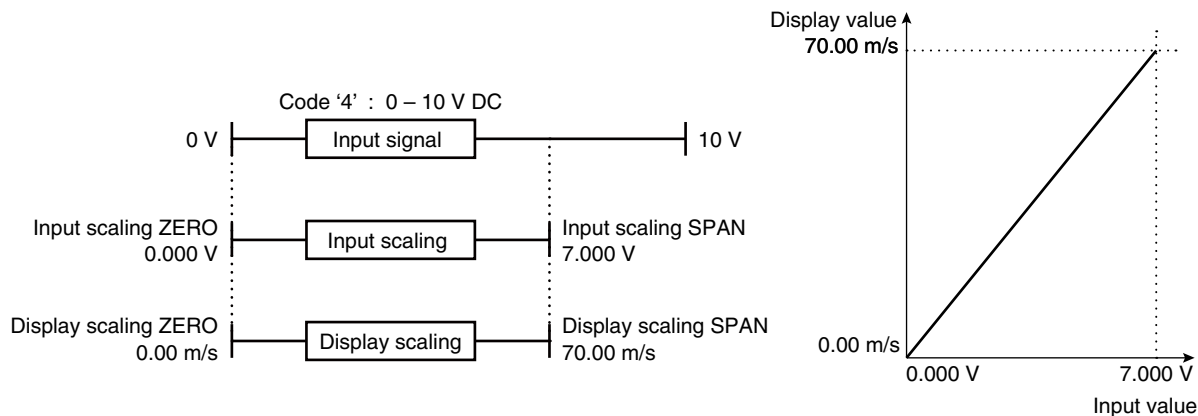

Input scaling: 0% input value (input scaling ZERO) and 100% input value (input scaling SPAN)

Display scaling: 0% display value (display scaling ZERO) and 100% display value (display scaling SPAN)

2.1.3 BASIC SETTING PROCEDURE

The following shows the procedure to set the input to 0 – 7 V DC and the display to 0.00 – 70.00 m/s with the input code '4' as an example. Set values meeting signals of an equipment to use. Refer to 3. SETTING SCALING VALUES for details of setting.

■ PARAMETER LIST FOR BASIC SETTING

Parameters used in the basic setting are as shown in the following table.

PARAMETER	SETTING VALUE	FUNCTION INDICATOR	SETTING
Input scaling ZERO	0.000	Zro, Tch	0% input: 0.000 V
Display scaling ZERO	0000 ^{*1}	Zro, D/P	0% display: 0.00 m/s
Input scaling SPAN	7.000	Spn, Tch	100% input: 7.000 V
Display scaling SPAN	7000 ^{*1}	Spn, D/P	100% display: 70.00 m/s
Decimal point position	00.00	D/P	2 decimal places (10 ⁻²)

*1 The decimal point position depends on the decimal point position setting.

■ BASIC SETTING PROCEDURE

The basic setting procedure is as follows.

1 Confirm the wiring, turn on the power and move on to Scaling Setting Mode (measurement stopped).

- Hold down Scale/↑ button for 3 seconds or more.

2 Set input scaling ZERO.

- Press Shift button to shift the display into the setting standby mode.
- Press Shift button to go to the next digit and Up button to change the blinking value.

3 Set display scaling ZERO.

- Press Alarm/↓ or Scale/↑ button to apply the new setting and go to the next or previous parameter setting.
- Press Shift button to shift the display into the setting standby mode.
- Press Shift button to go to the next digit and Up button to change the blinking value.

4 Set input scaling SPAN.

- Press Alarm/↓ or Scale/↑ button to apply the new setting and go to the next or previous parameter setting.
- Press Shift button to shift the display into the setting standby mode.
- Press Shift button to go to the next digit and Up button to change the blinking value.

5 Set display scaling SPAN.

- Press Alarm/↓ or Scale/↑ button to apply the new setting and go to the next or previous parameter setting.
- Press Shift button to shift the display into the setting standby mode.
- Press Shift button to go to the next digit and Up button to change the blinking value.

6 Set decimal point position.

- Press Alarm/↓ or Scale/↑ button to apply the new setting and go to the next or previous parameter setting.
- Press Shift button to shift the display into the setting standby mode and Up button to select the decimal point position.

7 Return to Measuring Mode (measurement started).

- Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to apply the new setting and return to Measuring Mode.

2.2 BASIC SETTING OPERATION AND INSTRUCTIONS

This section describes basic operation and instructions when setting parameters.


2.2.1 BASIC SETTING OPERATION

Parameters can be grouped into three setting types, “numerical value setting,” “setting value selection” and “decimal point position selection”. Basic operation of each type is as shown below.

■ NUMERICAL VALUE SETTING


1 Press Shift button to shift the display into the setting standby mode.

- The most significant digit starts blinking.

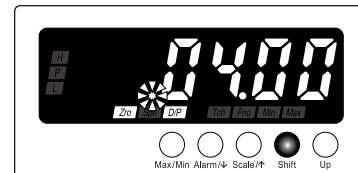


2 Press Shift and Up buttons to set a numerical value.

- Press Shift button to go to the next digit.
- Press Up button to change the blinking value.

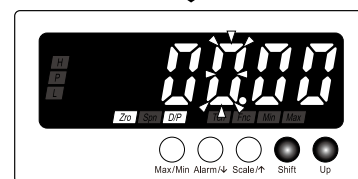

3 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- The next or previous parameter setting is indicated.

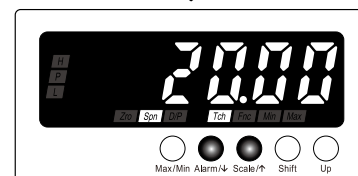


*1 Display depends on the specifications and settings.

NOTE


■ SHIFTING DIGITS

Each time pressing Shift button, the blinking digit moves to the right.

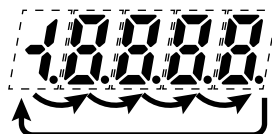


■ SETTING A NUMERICAL VALUE

- Each time pressing Up button, the numeral is incremented by 1. In setting an alarm setpoint, the indication following '9' will be '-'.
- The negative sign (-) must be set to the leftmost digit. For example, set '-04.00' instead of '-4.00'.

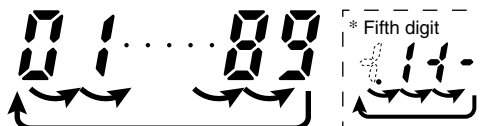


■ SETTING VALUE SELECTION


- 1 Press Shift button to shift the display into the setting standby mode.
 - The current set value starts blinking.

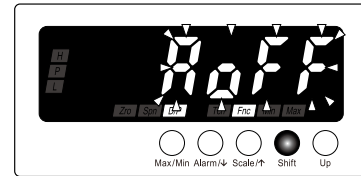

- 2 Press Up button to select your desired setting value.

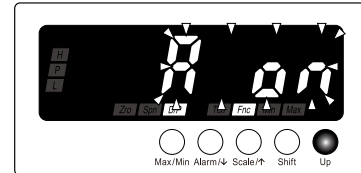


- 3 Press Alarm/↓ or Scale/↑ button to apply the new setting.
 - The next or previous parameter setting is indicated.

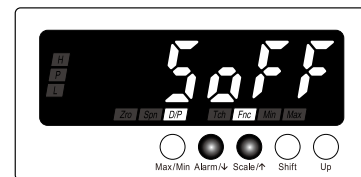


*1 Display depends on the specifications and settings.

■ DECIMAL POINT POSITION SELECTION

- 1 Press Shift button to shift the display into the setting standby mode.
 - The current set value starts blinking.

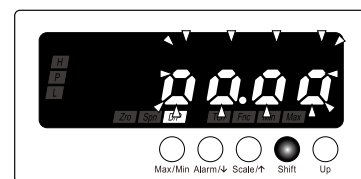

- 2 Press Up button to select a desired decimal point position.

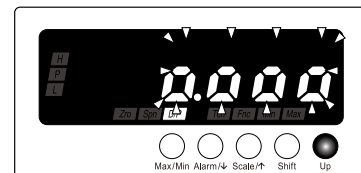

- 3 Press Alarm/↓ or Scale/↑ button to apply the new setting.
 - The next or previous parameter setting is indicated.




*1 Display depends on the specifications and settings.

NOTE

■ MOVING THE DECIMAL POINT

Pressing Up button moves the decimal point one place to the left.

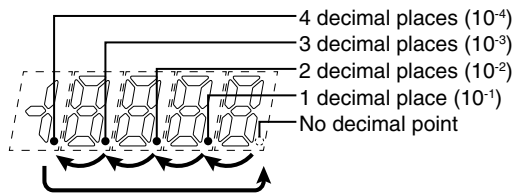

■ DECIMAL POINT POSITION

“No decimal point” to “4 decimal places” can be selected in the decimal point position setting.

SETTING VALUE	FUNCTION	SETTING VALUE	FUNCTION
0.0000	No decimal point	0.0000	3 decimal places (10^{-3})
0.0000	1 decimal place (10^{-1})	0.0000	4 decimal places (10^{-4})
0.0000	2 decimal places (10^{-2})		

2.2.2 INSTRUCTIONS ON BASIC OPERATION

■ INVALID PARAMETERS

- ‘Max’ and ‘Min’ indicators start blinking when a parameter is within invalid range (following cases). Return the setting within the valid range.
 - In setting an input scaling value beyond the setting range, or setting ‘input scaling ZERO \geq input scaling SPAN’.
 - In setting ‘display scaling ZERO = display scaling SPAN’.
 - In setting the negative sign (-) to a digit other than the leftmost one.

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...

- The display goes back automatically to Measuring Mode without applying the last changes after the specified time period (default: 60 sec.) while it is in the setting standby mode.
- The display goes back automatically to Measuring Mode after the specified time period (default: 60 sec.) while it is in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

- Hold down Max/Min button for 3 seconds or more to return to Measuring Mode without applying the last changes while the display is in the setting standby mode.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

■ IN MOVING ON TO EACH SETTING MODE FROM MEASURING MODE

- The last values of the alarm outputs before mode transition are held.

■ ORDER TO DISPLAY PARAMETERS

- Refer to 5. PARAMETER CONFIGURATION for details.

3. SETTING SCALING VALUES

■ INPUT SCALING

Input scaling means setting an input value within the setting range (conformance range) per input code. The input scaling values include ZERO and SPAN.

- Input scaling ZERO is minimum value (0%) of input signal.
- Input scaling SPAN is maximum value (100%) of input signal.

e.g. Input signal 0 – 7 V DC
Input scaling ZERO 0 V
Input scaling SPAN 7 V

IMPORTANT

- Set 'input scaling ZERO < input scaling SPAN'.
- Setting beyond the setting range is not available.
- Input scaling ZERO and input scaling SPAN can be adjusted by applying actual input signals. Refer to 13.1 TEACH CALIBRATION for details.

■ DISPLAY SCALING

Display scaling means setting a value to display actually.

The display scaling values include ZERO and SPAN. A decimal point can be set in any position.

- Display scaling ZERO is a display value for the input scaling ZERO.
- Display scaling SPAN is a display value for the input scaling SPAN.
- Decimal point position can be set in common for both display scaling ZERO and SPAN.


e.g. Display value 0.00 – 70.00 m/s
Display scaling ZERO 0.00 m/s
Display scaling SPAN 70.00 m/s
Decimal point position oo.oo (2 decimal places)

IMPORTANT

Both normal scaling (display scaling ZERO < display scaling SPAN) and inverted scaling (display scaling ZERO > display scaling SPAN) can be set within the range of -19999 to 19999.


■ Normal Scaling

The display value increases when the input signal increases.

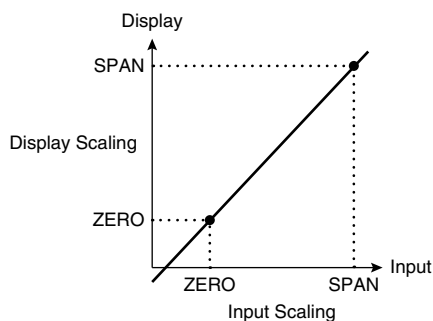

■ Inverted Scaling


The display value decreases when the input signal increases.

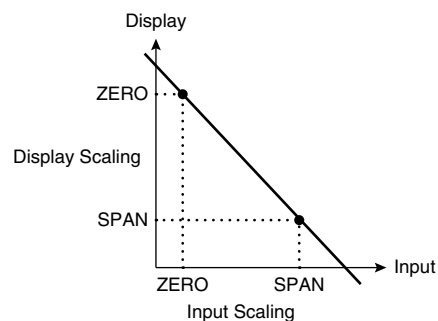

RELATION BETWEEN INPUT SCALING AND DISPLAY SCALING

The relation between input scaling and display scaling is as shown in the following figure.


e.g. Input code '4', to display 0 – 7 V DC input as 0.00 – 70.00 m/s

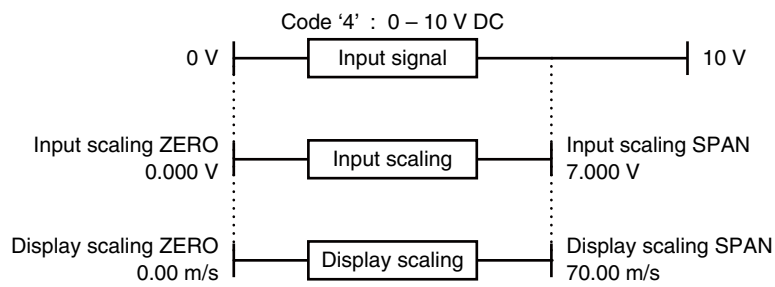

PROCEDURE TO SET SCALING VALUES

• Flow in setting scaling values

5-step settings are necessary to set scaling values.

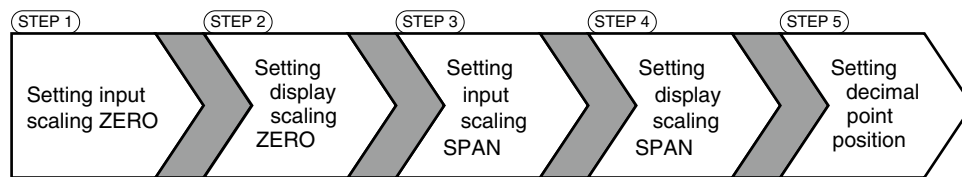

• Operating procedure to set scaling values

 
 

 
Following pages describe operating procedures in each step to set the input scaling to 0 – 7 V DC, and the display scaling to 0.00 – 70.00 m/s with the input code '4' as an example.

3.1 STEP 1. INPUT SCALING ZERO

 

 
 
 
 

 
 
 
3.1.1 INPUT SCALING LIST

Input scaling default values and setting ranges are as shown in the following tables.

■ CURRENT INPUT

INPUT SIGNAL	DEFAULT VALUE	SETTING RANGE
A: 4 – 20 mA DC	Input scaling ZERO:  Input scaling SPAN: 	4.00 – 20.00 mA
D: 0 – 20 mA DC	Input scaling ZERO:  Input scaling SPAN: 	0.00 – 20.00 mA


■ VOLTAGE INPUT

INPUT SIGNAL	DEFAULT VALUE	SETTING RANGE
4: 0 – 10 V DC	Input scaling ZERO:  Input scaling SPAN: 	0.000 – 10.000 V
5: 0 – 5 V DC	Input scaling ZERO:  Input scaling SPAN: 	0.000 – 5.000 V
6: 1 – 5 V DC	Input scaling ZERO:  Input scaling SPAN: 	1.000 – 5.000 V
4W: -10 – +10 V DC	Input scaling ZERO:  Input scaling SPAN: 	-10.000 – +10.000 V
5W: -5 – +5 V DC	Input scaling ZERO:  Input scaling SPAN: 	-5.000 – +5.000 V

NOTE


■ SHIFTING DIGITS

Each time pressing Shift button, the blinking digit moves to the right.

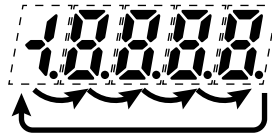


■ SETTING A NUMERICAL VALUE

- Each time pressing Up button, the numeral is incremented by 1.

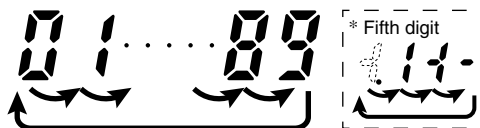

3.1.2 OPERATING PROCEDURE

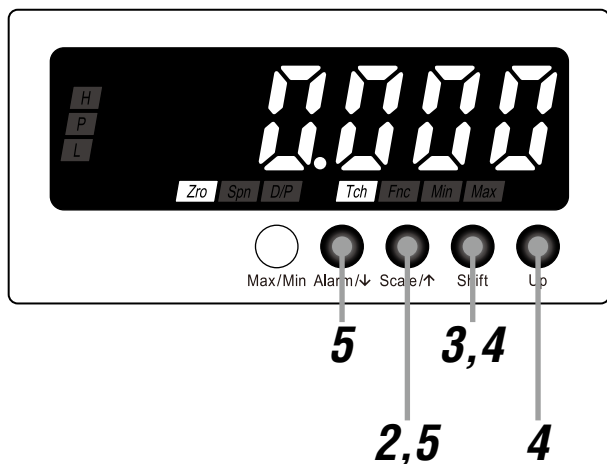

NOTE

The left figure shows a display example (default value of input code '4'). The display depends on the specifications and settings. Refer to 3.1.1 INPUT SCALING LIST for details.


1 Confirm the wiring, and turn on the power.

- All the indications turn on for approximately 5 seconds and then the display moves on to Measuring Mode.

NOTE

Indication 'S.ERR' may blink, which shows the input out of the measurable range and does not show the unit failure.

- Immediately after power on (all indicators on)

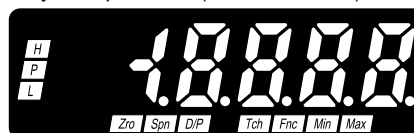

- Measuring Mode



*1 Display depends on the specifications, settings and input.

2 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



NOTE

Skip to Step 6 if the default value is acceptable.


3 Press Shift button to shift the display into the setting standby mode.

- The fifth digit starts blinking, to which you can apply changes.



4 Press Shift and Up buttons to set to '0.000'.

- Press Shift button to go to the next digit and Up button to change the blinking value.

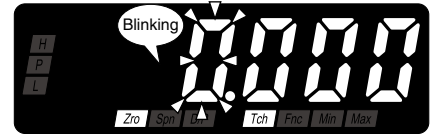

NOTE

- '0.000' is a display example. Set any value within the setting range.
- 'Min' and 'Max' indicators start blinking when the set value is within invalid range or is same as the input scaling SPAN. Return the setting within the valid range.
- The negative sign (-) must be set to the leftmost digit. For example, set '-04.00' instead of '-4.00'.

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the display scaling ZERO will be indicated within the range of -19999 to 19999 depending on the setting.
- Press Scale/↑ button, and the decimal point position will be indicated.

6 ■ TO GO ON TO SET THE DISPLAY SCALING ZERO, Skip to Step 3 in "3.2 STEP 2. DISPLAY SCALING ZERO"

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

NOTE

■ INPUT SCALING SETTING

- Do not set 'input scaling ZERO \geq input scaling SPAN'.

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...

- The display goes back automatically to Measuring Mode without applying the last changes after the setting time out period (default: 60 sec.) in the setting standby mode (indication blinking in Step 3 and 4).
- The display goes back automatically to Measuring Mode after the setting time out period (default: 60 sec.) in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

 
 
 
 
 

- Hold down Max/Min button for 3 seconds or more in the setting standby mode (indication blinking in Step 3 and 4) to return to Measuring Mode without applying the last changes.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

3.2 STEP 2. DISPLAY SCALING ZERO

 

 
 
 
 
 
 

 
 

3.2.1 DISPLAY SCALING LIST

Display scaling default values and setting ranges are as shown in the following tables.

■ CURRENT INPUT

INPUT SIGNAL	DEFAULT VALUE	SETTING RANGE
A: 4 – 20 mA DC	Display scaling ZERO:  Display scaling SPAN: 	 to 
D: 0 – 20 mA DC	Display scaling ZERO:  Display scaling SPAN: 	


■ VOLTAGE INPUT

INPUT SIGNAL	DEFAULT VALUE	SETTING RANGE
4: 0 – 10 V DC	Display scaling ZERO:  Display scaling SPAN: 	 to 
5: 0 – 5 V DC	Display scaling ZERO:  Display scaling SPAN: 	
6: 1 – 5 V DC	Display scaling ZERO:  Display scaling SPAN: 	
4W: -10 – +10 V DC	Display scaling ZERO:  Display scaling SPAN: 	
5W: -5 – +5 V DC	Display scaling ZERO:  Display scaling SPAN: 	

NOTE

■ SHIFTING DIGITS

Each time pressing Shift button, the blinking digit moves to the right.

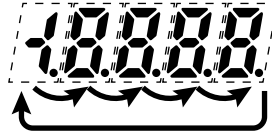


■ SETTING A NUMERICAL VALUE

- Each time pressing Up button, the numeral is incremented by 1.



3.2.2 OPERATING PROCEDURE

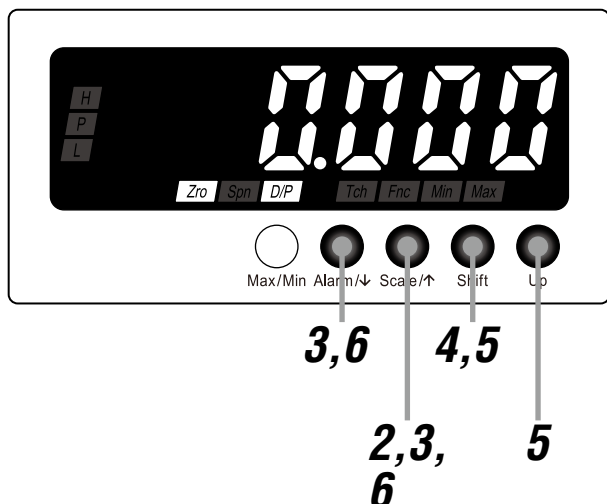

NOTE

The left figure shows a display example (default value of input code '4'). The display depends on the specifications and settings. Refer to 3.2.1 DISPLAY SCALING LIST for details.


1 Confirm the wiring, and turn on the power.

- All the indications turn on for approximately 5 seconds and then the display moves on to Measuring Mode.

NOTE

Indication 'S.ERR' may blink, which shows the input out of the measurable range and does not show the unit failure.

- Immediately after power on (all indicators on)

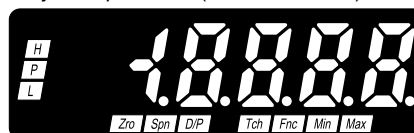

- Measuring Mode



*1 Display depends on the specifications, settings and input.

2 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



3 Press Alarm/↓ or Scale/↑ button to go to the display scaling ZERO setting.

- The display scaling ZERO is indicated.
- 'Zro' and 'D/P' indicators turn on.




NOTE

Skip to Step 7 if the default value is acceptable.


4 Press Shift button to shift the display into the setting standby mode.

- The fifth digit starts blinking, to which you can apply changes.

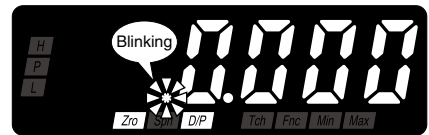

5 Press Shift and Up buttons to set to '0.000'.

- Press Shift button to go to the next digit and Up button to change the blinking value.

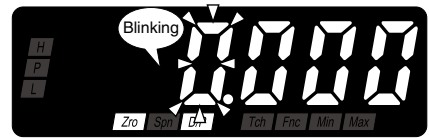

NOTE

- '0.000' is a display example. Set any value within the range of -19999 to 19999.
- The decimal point position depends on the decimal point position setting. Disregard the decimal point here.
- 'Min' and 'Max' indicators start blinking when the set value is same as the display scaling SPAN. Return the setting within the valid range.
- The negative sign (-) must be set to the leftmost digit. For example, set '-04.00' instead of '-4.00'

6 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the input scaling SPAN will be indicated.
- Press Scale/↑ button, and the input scaling ZERO will be indicated.

7 ■ TO GO ON TO SET THE INPUT SCALING SPAN,
Skip to Step 3 in "3.3 STEP 3. INPUT SCALING SPAN"

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

NOTE

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...


- The display goes back automatically to Measuring Mode without applying the last changes after the setting time out period (default: 60 sec.) in the setting standby mode (indication blinking in Step 4 and 5).
- The display goes back automatically to Measuring Mode after the setting time out period (default: 60 sec.) in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

- Hold down Max/Min button for 3 seconds or more in the setting standby mode (indication blinking in Step 4 and 5) to return to Measuring Mode without applying the last changes.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

3.3 STEP 3. INPUT SCALING SPAN

3.3.1 OPERATING PROCEDURE

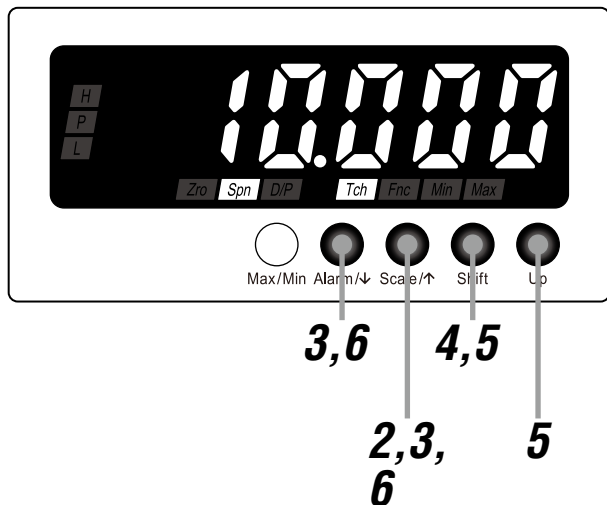

NOTE

The left figure shows a display example (default value of input code '4'). The display depends on the specifications and settings. Refer to 3.1.1 INPUT SCALING LIST for details.

1 Confirm the wiring, and turn on the power.

- All the indications turn on for approximately 5 seconds and then the display moves on to Measuring Mode.

NOTE

Indication 'S.ERR' may blink, which shows the input out of the measurable range and does not show the unit failure.

- Immediately after power on (all indicators on)



- Measuring Mode



*1 Display depends on the specifications, settings and input.

2 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



3 Press Alarm/↓ or Scale/↑ button to go to the input scaling SPAN setting.

- The input scaling SPAN is indicated.
- 'Spn' and 'Tch' indicators turn on.




NOTE

Skip to Step 7 if the default value is acceptable.


4 Press Shift button to shift the display into the setting standby mode.

- The fifth digit starts blinking, to which you can apply changes.

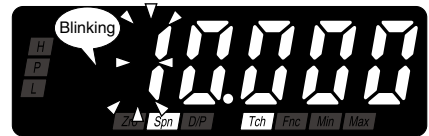

5 Press Shift and Up buttons to set to '7.000'.

- Press Shift button to go to the next digit and Up button to change the blinking value.

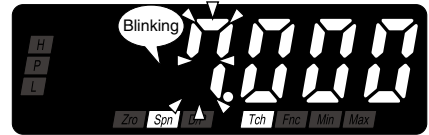

NOTE

- '7.000' is a display example. Set any value within the setting range.
- 'Min' and 'Max' indicators start blinking when the set value is within invalid range or is same as the input scaling ZERO. Return the setting within the valid range.
- The negative sign (-) must be set to the leftmost digit. For example, set '-04.00' instead of '-4.00'

6 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the display scaling SPAN will be indicated within the range of -19999 to 19999 depending on the setting.
- Press Scale/↑ button, and the display scaling ZERO will be indicated within the range of -19999 to 19999 depending on the setting.

7 ■ TO GO ON TO SET THE DISPLAY SCALING SPAN,
Skip to Step 3 in "3.4 STEP 4. DISPLAY SCALING SPAN"

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

NOTE

■ INPUT SCALING SETTING

- Do not set 'input scaling ZERO ≥ input scaling SPAN'

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...


- The display goes back automatically to Measuring Mode without applying the last changes after the setting time out period (default: 60 sec.) in the setting standby mode (indication blinking in Step 4 and 5).
- The display goes back automatically to Measuring Mode after the setting time out period (default: 60 sec.) in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

- Hold down Max/Min button for 3 seconds or more in the setting standby mode (indication blinking in Step 4 and 5) to return to Measuring Mode without applying the last changes.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

3.4 STEP 4. DISPLAY SCALING SPAN

3.4.1 OPERATING PROCEDURE

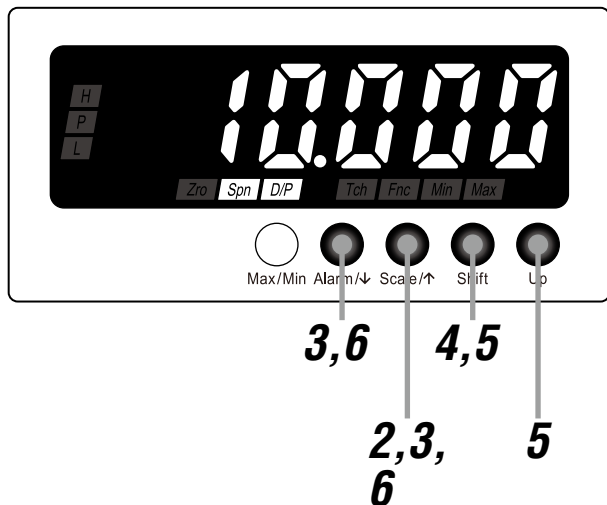

NOTE

The left figure shows a display example (default value of input code '4'). The display depends on the specifications and settings. Refer to 3.2.1 DISPLAY SCALING LIST for details.

1 Confirm the wiring, and turn on the power.

- All the indications turn on for approximately 5 seconds and then the display moves on to Measuring Mode.

■ Immediately after power on (all indicators on)



■ Measuring Mode



*1 Display depends on the specifications, settings and input.

NOTE

Indication 'S.ERR' may blink, which shows the input out of the measurable range and does not show the unit failure.


2 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



3 Press Alarm/↓ or Scale/↑ button to go to the display scaling SPAN setting.

- The display scaling SPAN is indicated.
- 'Spn' and 'D/P' indicators turn on.

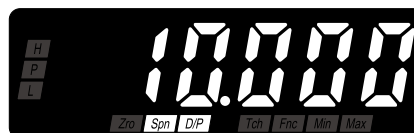


NOTE

Skip to Step 7 if the default value is acceptable.


4 Press Shift button to shift the display into the setting standby mode.

- The fifth digit starts blinking, to which you can apply changes.

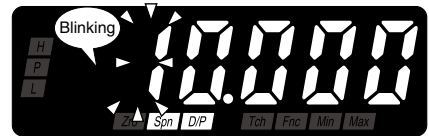

5 Press Shift and Up buttons to set to '7.000'.

- Press Shift button to go to the next digit and Up button to change the blinking value.

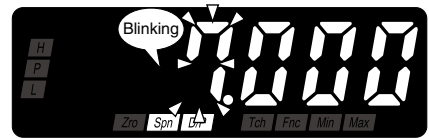

NOTE

- '7.000' is a display example. Set any value within the range of -19999 to 19999.
- The decimal point position depends on the decimal point position setting. Disregard the decimal point here.
- 'Min' and 'Max' indicators start blinking when the set value is same as the display scaling ZERO. Return the setting within the valid range.
- The negative sign (-) must be set to the leftmost digit. For example, set '-04.00' instead of '-4.00'

6 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the decimal point position will be indicated.
- Press Scale/↑ button, and the input scaling SPAN will be indicated.

7 ■ TO GO ON TO SET THE DECIMAL POINT POSITION,
Skip to Step 3 in "3.5 STEP 5. DECIMAL POINT POSITION"

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

NOTE

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...

- The display goes back automatically to Measuring Mode without applying the last changes after the setting time out period (default: 60 sec.) in the setting standby mode (indication blinking in Step 4 and 5).
- The display goes back automatically to Measuring Mode after the setting time out period (default: 60 sec.) in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

- Hold down Max/Min button for 3 seconds or more in the setting standby mode (indication blinking in Step 4 and 5) to return to Measuring Mode without applying the last changes.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

3.5 STEP 5. DECIMAL POINT POSITION

3.5.1 DECIMAL POINT POSITION LIST

Default values of decimal point position are as shown in the following tables.

■ CURRENT INPUT

INPUT SIGNAL	DEFAULT VALUE
A: 4 – 20 mA DC	<input type="text" value="0.0000"/> 2 decimal places (10^{-2})
D: 0 – 20 mA DC	<input type="text" value="0.0000"/> 2 decimal places (10^{-2})


■ VOLTAGE INPUT

INPUT SIGNAL	DEFAULT VALUE
4: 0 – 10 V DC	<input type="text" value="0.0000"/> 3 decimal places (10^{-3})
5: 0 – 5 V DC	<input type="text" value="0.0000"/> 3 decimal places (10^{-3})
6: 1 – 5 V DC	<input type="text" value="0.0000"/> 3 decimal places (10^{-3})
4W: -10 – +10 V DC	<input type="text" value="0.0000"/> 3 decimal places (10^{-3})
5W: -5 – +5 V DC	<input type="text" value="0.0000"/> 3 decimal places (10^{-3})

NOTE

■ MOVING THE DECIMAL POINT

Pressing Up button moves the decimal point one place to the left.

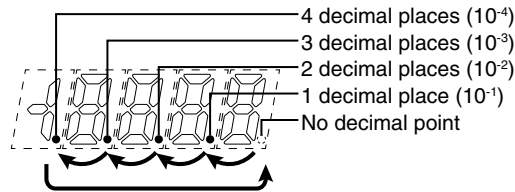


■ DECIMAL POINT POSITION

“No decimal point” to “4 decimal places” can be selected in the decimal point position setting.

SETTING VALUE	FUNCTION	SETTING VALUE	FUNCTION
<input type="text" value="0.0000"/>	No decimal point	<input type="text" value="0.0000"/>	3 decimal places (10^{-3})
<input type="text" value="0.0000"/>	1 decimal place (10^{-1})	<input type="text" value="0.0000"/>	4 decimal places (10^{-4})
<input type="text" value="0.0000"/>	2 decimal places (10^{-2})		

3.5.2 OPERATING PROCEDURE

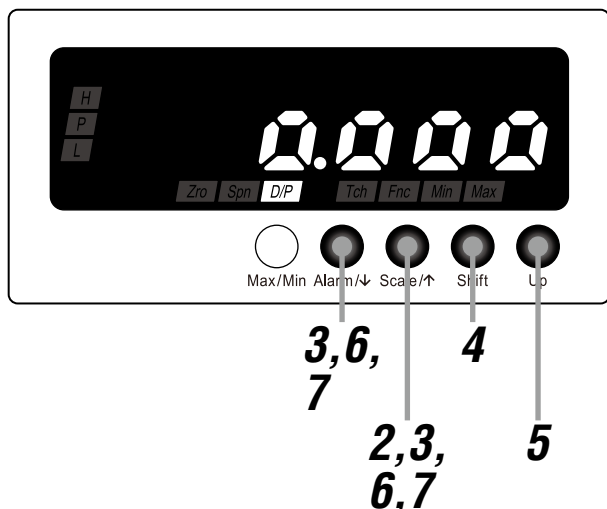

NOTE

The left figure shows a display example. The display depends on the specifications and settings. Refer to 3.5.1 DECIMAL POINT POSITION LIST for details.


1 Confirm the wiring, and turn on the power.

- All the indications turn on for approximately 5 seconds and then the display moves on to Measuring Mode.

NOTE

Indication 'S.ERR' may blink, which shows the input out of the measurable range and does not show the unit failure.

- Immediately after power on (all indicators on)

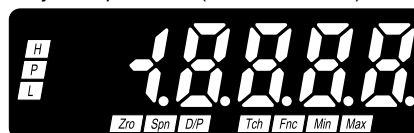

- Measuring Mode



*1 Display depends on the specifications, settings and input.

2 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



3 Press Alarm/↓ or Scale/↑ button to go to the decimal point position setting.

- The decimal point position is indicated.
- 'D/P' indicator turns on.




NOTE

Skip to Step 7 if the default value is acceptable.


4 Press Shift button to shift the display into the setting standby mode.

- The indication starts blinking, to which you can apply changes.

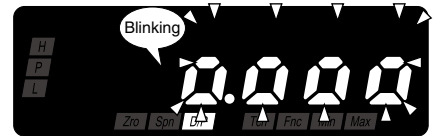

5 Press Up button to select the decimal point position.

- Select 2 decimal places (10^{-2}).
- Press Up button to move the decimal point.

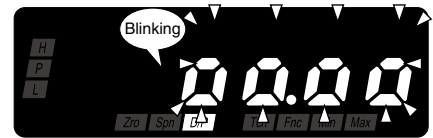

NOTE

The right figure shows a display example. Select one among “no decimal point,” and “1 decimal place” to “4 decimal places”

6 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the input scaling ZERO will be indicated.
- Press Scale/↑ button, and the display scaling SPAN will be indicated within the range of -19999 to 19999 depending on the setting.

7 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

NOTE

■ IF THE FRONT BUTTONS ARE LEFT UNTOUCHED...

- The display goes back automatically to Measuring Mode without applying the last changes after the setting time out period (default: 60 sec.) in the setting standby mode (indication blinking in Step 4 and 5).
- The display goes back automatically to Measuring Mode after the setting time out period (default: 60 sec.) in one of the other modes.
- The setting time out is configurable. (Refer to 10. GOING BACK AUTOMATICALLY TO MEASURING MODE.)

■ TO ABORT A SETTING...

- Hold down Max/Min button for 3 seconds or more in the setting standby mode (indication blinking in Step 4 and 5) to return to Measuring Mode without applying the last changes.
- If you get lost in a setting mode, you can execute initialization. (Refer to 15.2 INITIALIZING SETTING VALUES.)

4. OPERATION

Make sure that 0.00 – 70.00 m/s is correctly indicated according to the input 0 – 7 V DC provided.

IMPORTANT

Before operating, make sure that the wiring is correct, the input and the power supply are within the specification range.

- 1 Apply 0 V input (0%) and make sure that 0.00 m/s is indicated.



*1 Display depends on the specifications, settings and input.


NOTE

■ WHEN THE FOLLOWING IS INDICATED...


- When 'S.ERR' is indicated, the input is not applied correctly. Check the input wiring, equipment and signal. When 'Min' indicator blinks, the input signal is under the specification voltage/current. And when 'Max' indicator blinks, the input is over the specification voltage/current.
- When the indication is shifted with 'Zro' and 'Fnc' indicators on, the Forced Zero is being executed. Cancel the Forced Zero. (Refer to 12.2 FORCING THE PRESENT DISPLAY VALUE TO ZERO.)

■ ALARM INDICATORS

- The status of the alarm indicators depend on the alarm setpoints. The above display examples show 'P' indicator on.

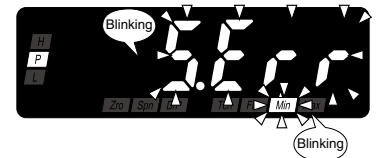

- 2 Apply 3.5 V input (50%) and make sure that 35.00 m/s is indicated.

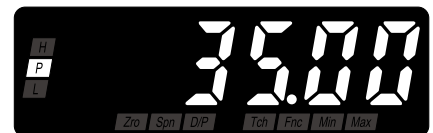

- 3 Apply 7 V input (100%) and make sure that 70.00 m/s is indicated.



NOTE

When the indication is shifted with the function indicators off, perform Teach Calibration. (Refer to 13.1 TEACH CALIBRATION.)


5. PARAMETER CONFIGURATION

■ MODE

Parameters can be grouped in several modes.
The 47NLVT has modes as shown in the following table.

MODE	FUNCTION	MEASUREMENT
Measuring	Normal measurement state where the unit takes in input and provides alarms. Present value, MAX and MIN values, alarm setpoints can be indicated in Measuring Mode. Also Forced Zero can be executed and canceled in this mode. When the power is supplied, the unit operates in Measuring Mode.	Measuring
Scaling Setting	Basic settings such like input scaling and display scaling, and Teach Calibration can be performed.	Measuring stopped
Alarm Setting	Alarm setpoints, trip action, deadband, trip delay and alarm output logic can be set.	
Advanced Setting	Moving average, low-end cutout and brightness can be set. Also the firmware version can be confirmed.	
Lockout Setting	Settings to prevent inadvertent button operation can be performed. Mode transition and set values can be locked.	

■ MODE TRANSITION

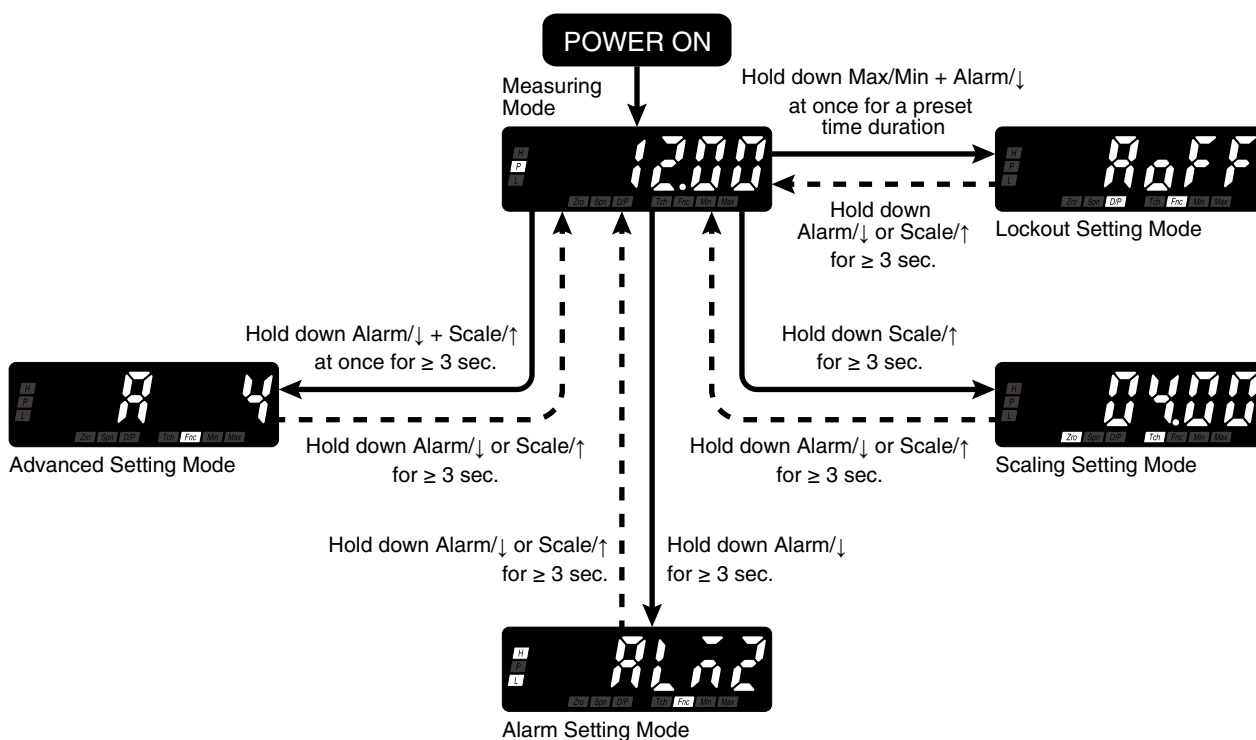

■ TRANSITION FROM MEASURING MODE TO EACH MODE

To Scaling Setting Mode	Hold down Scale/↑ button for 3 seconds or more.
To Alarm Setting Mode	Hold down Alarm/↓ button for 3 seconds or more.
To Advanced Setting Mode	Hold down Alarm/↓ + Scale/↑ buttons at once for 3 seconds or more.
To Lockout Setting Mode	Hold down Max/Min + Alarm/↓ buttons at once for a preset time duration.


■ TRANSITION FROM EACH MODE TO MEASURING MODE

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

■ SHIFTING THROUGH SETTING PARAMETERS

(1) Parameter shifting in Scaling Setting Mode

In Scaling Setting Mode, pressing Alarm/↓ button shifts one parameter to the next (clockwise in the following figure). Pressing Scale/↑ button shifts one to the previous (counterclockwise).

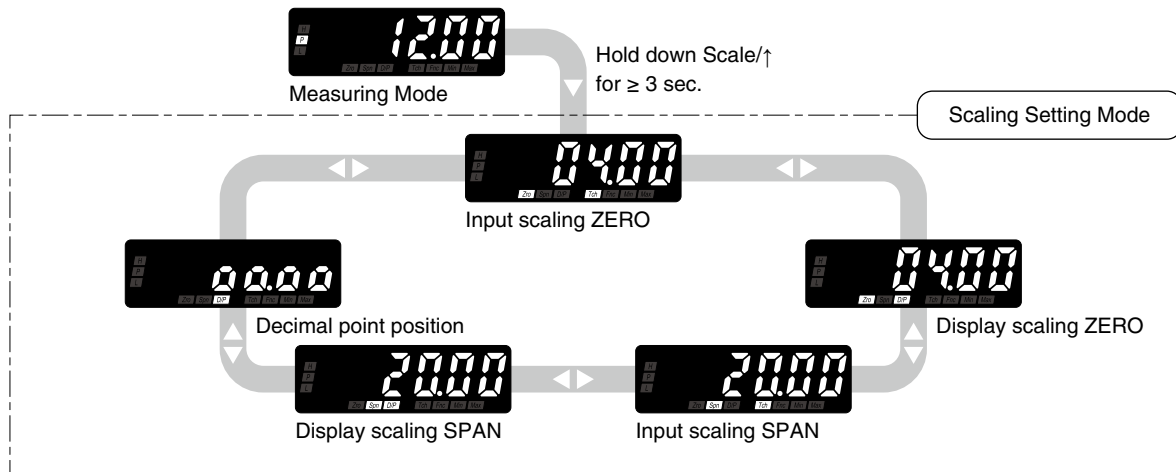


NOTE

- The display depends on the specifications, settings and input. The above displays show default values with the input code 'A'
- Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode from each parameter.

(2) Parameter shifting in Alarm Setting Mode

In Alarm Setting Mode, pressing Alarm/↓ button shifts one parameter to the next (clockwise in the following figure). Pressing Scale/↑ button shifts one to the previous (counterclockwise).

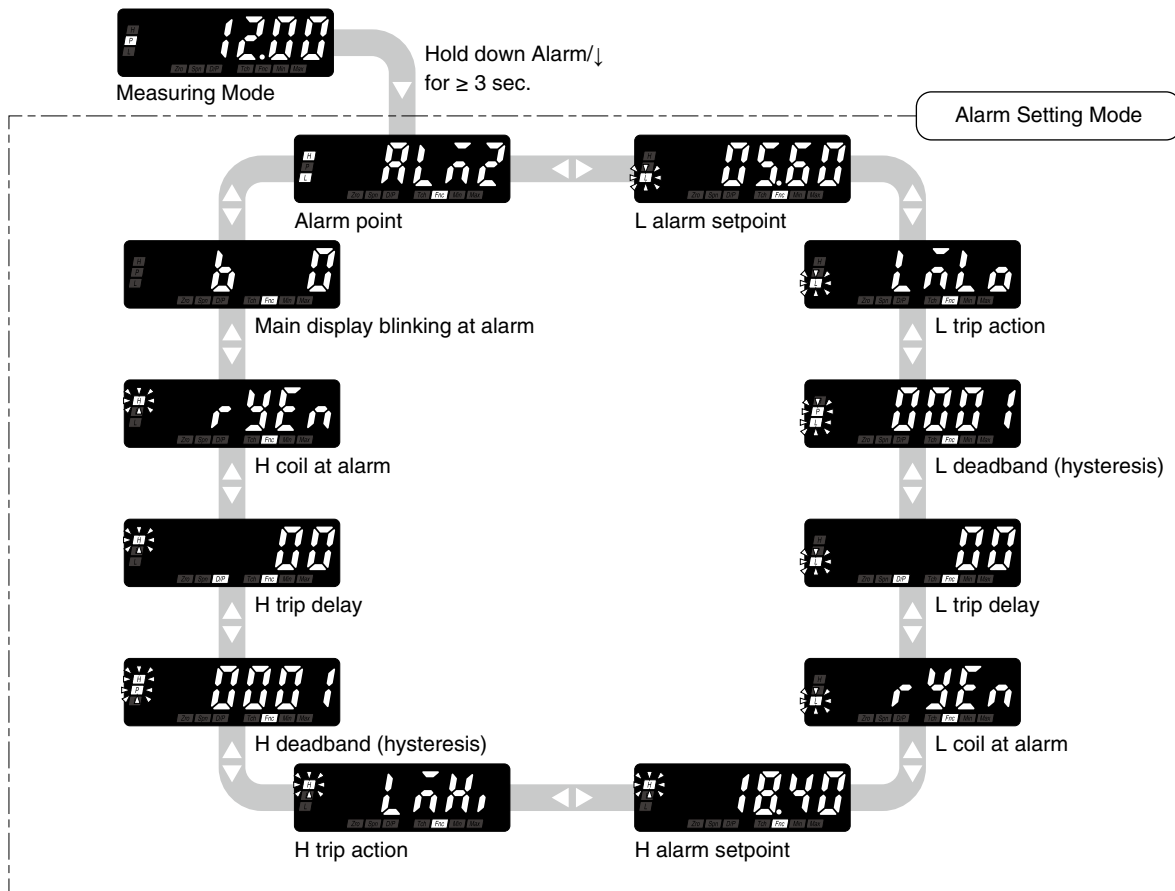


NOTE

- The display depends on the specifications, settings and input. The above displays show default values with the input code 'A'
- Alarm Setting Mode is locked when "No alarm" is selected for the alarm point parameter.
- Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode from each parameter.

(3) Parameter shifting in Advanced Setting Mode

In Advanced Setting Mode, pressing Alarm/↓ button shifts one parameter to the next (clockwise in the following figure). Pressing Scale/↑ button shifts one to the previous (counterclockwise).

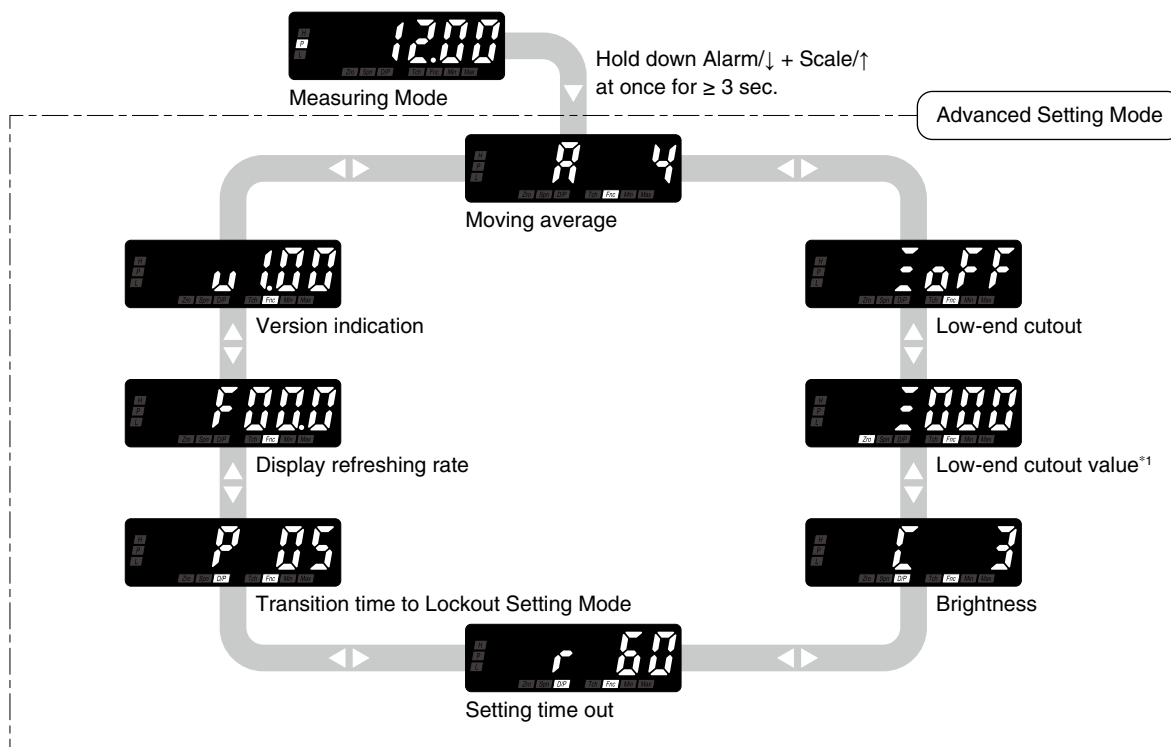


*1 With the cutout set to OFF, the low-end cutout value setting is locked.

NOTE

- The display depends on the specifications, settings and input. The above displays show default values.
- Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode from each parameter.

(4) Parameter shifting in Lockout Setting Mode

In Lockout Setting Mode, pressing Alarm/↓ button shifts one parameter to the next (clockwise in the following figure). Pressing Scale/↑ button shifts one to the previous (counterclockwise).

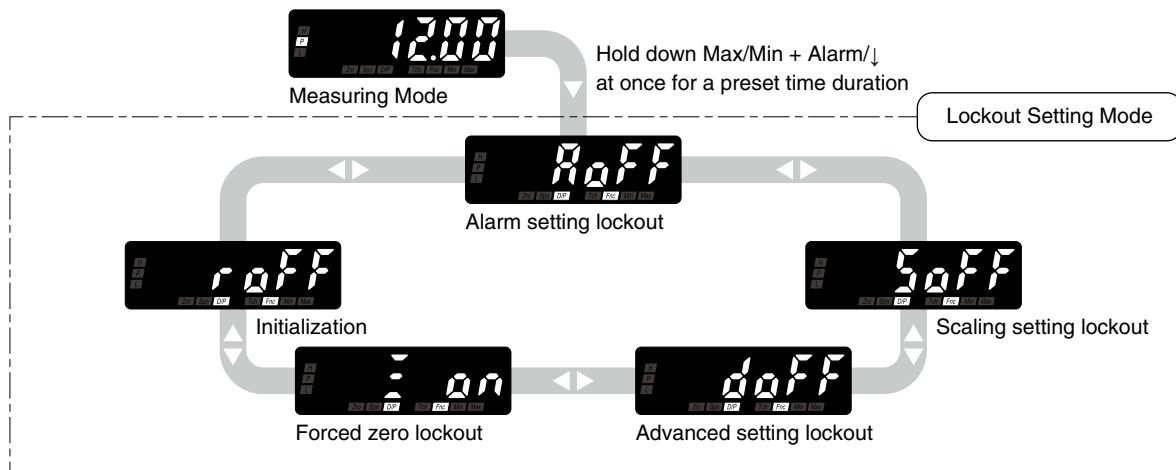

NOTE

- The display depends on the specifications, settings and input. The above displays show default values.
- Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode from each parameter.

6. SETTING ALARM OUTPUT

The unit compares the present value with the alarm setpoints, and provides an alarm output (photo MOSFET relay). You can configure parameters as alarm conditions as shown in Tables 1 and 2. Figures 1 to 5 show alarm examples using each parameter.

■ TABLE 1: ALARM OUTPUT PARAMETERS

PARAMETER	FUNCTION
Alarm point	Dual alarm or no alarm
Alarm setpoint	Setpoint value within the range of -19999 to 19999 for the display value
Trip action	High or low trip Configuring typical L/H trip setting (Figure 1) or all trip points to high or low setting (Figure 2) is available. 'P' indicator turns on when none of the other alarms is tripped.
Deadband (hysteresis)	Once a high (low) trip alarm is ON, the alarm stays ON until the data becomes lower (higher) than the dead band value from the setpoint, which prevents the alarm output from chattering when the display value fluctuates slightly near the setpoint (Figure 3). Deadband works in the direction of increasing the display value for low trip and in the direction of decreasing it for high.
Trip delay	Alarm output is provided when the display value exceeds the setpoint and stayed for the specified time duration, which prevents the alarm output from being provided by a sudden change such like external disturbance and starting current (Figure 4).
Coil at alarm	Alarm output logic, coil energized or de-energized at alarm (Figure 5).
Main display blinking at alarm	Main display blinking interval at alarm can be selected among 5 intervals (Table 2).

■ TABLE 2: SETTING VALUES

PARAMETER	DISPLAY	FUNCTION	DEFAULT VALUE
Alarm point	<input type="text" value="ALn2"/>	Dual alarm	<input type="text" value="ALn2"/>
	<input type="text" value="ALn0"/>	No alarm	
Alarm setpoint	<input type="text" value="19999"/> to <input type="text" value="19999"/>	-19999 to 19999	Refer to 6.2.1 ALARM SETPOINT LIST for details.
Trip action	<input type="text" value="LnLo"/>	Lo trip	L trip action: <input type="text" value="LnLo"/>
	<input type="text" value="LnHi"/>	Hi trip	H trip action: <input type="text" value="LnHi"/>
Deadband (hysteresis)	<input type="text" value="0000"/> to <input type="text" value="9999"/>	0000 – 9999	<input type="text" value="0000"/>
Trip delay	<input type="text" value="00"/> to <input type="text" value="99"/>	0 – 99 seconds	<input type="text" value="00"/>
Coil at alarm	<input type="text" value="rYEn"/>	Coil energized at alarm	<input type="text" value="rYEn"/>
	<input type="text" value="rYdn"/>	Coil de-energized at alarm	
Main display blinking at alarm	<input type="text" value="b 0"/>	No blinking	<input type="text" value="b 0"/>
	<input type="text" value="b 1"/>	Blinking in 1.0 second intervals	
	<input type="text" value="b 2"/>	Blinking in 0.5 second intervals	
	<input type="text" value="b 3"/>	Blinking in 0.2 second intervals	
	<input type="text" value="b 4"/>	Blinking in 0.1 second intervals	

Figure 1: Typical L/H trip setting


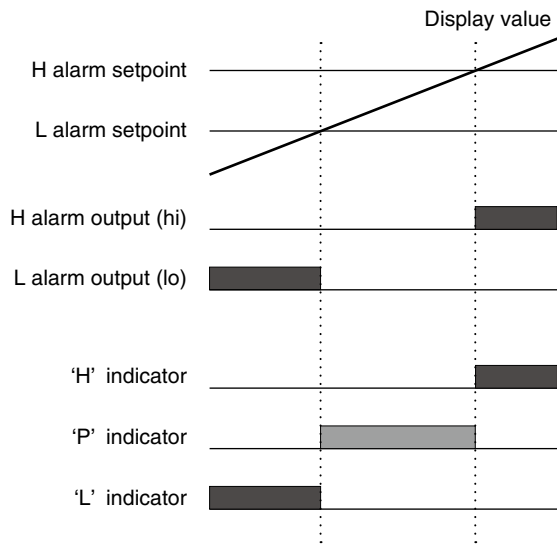


Figure 2: All trip points set to high setting

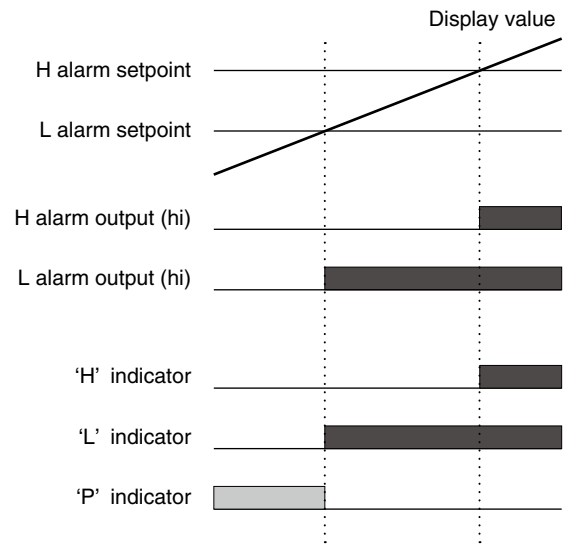

Low or high trip action can be set for each alarm output. 'L' and 'H' indicators are fixed for each alarm output. Therefore, even in case setting L alarm output to high trip action, for example, 'L' indicator turns on at alarm.

Figure 3: Deadband (hysteresis)



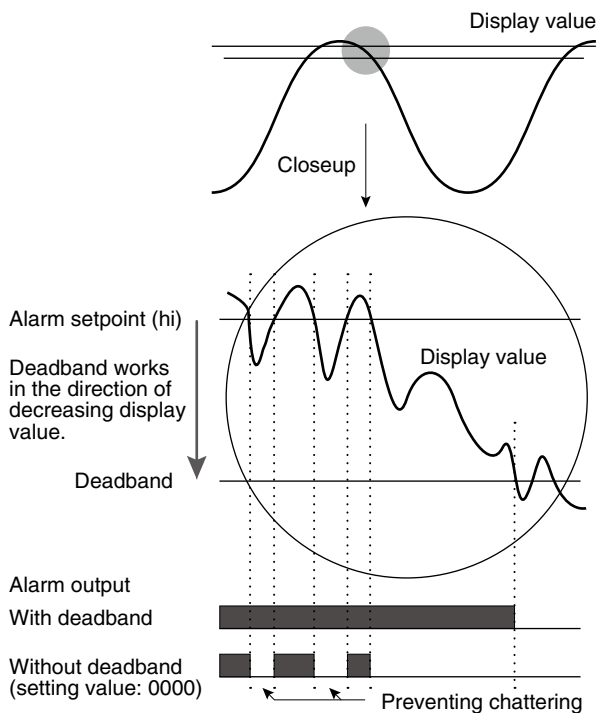


Figure 4: Trip delay

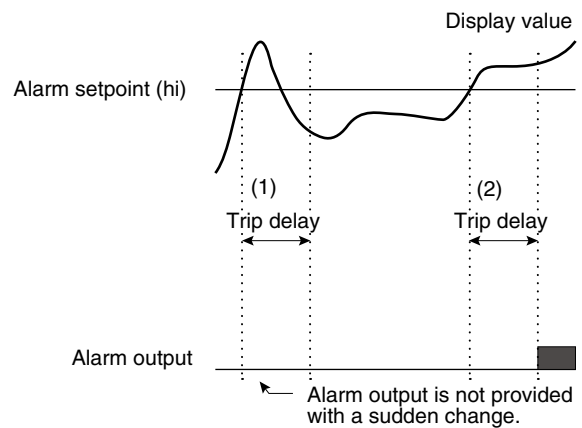

- (1) The display value once exceeds the alarm setpoint but becomes below it during trip delay time period. Therefore alarm output is not provided.
- (2) The display value exceeds the setpoint and stays over the trip delay time period. Therefore alarm output is provided.

Figure 5: Coil at alarm

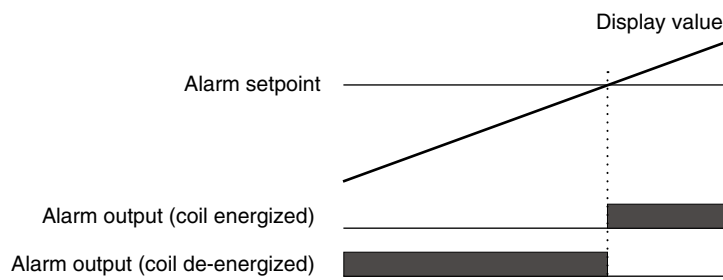

In order to stop operation of an equipment when the display value exceeds the setpoint, for instance, set reversal output logic, "coil de-energized".


IMPORTANT

- When indication 'S.ERR' and 'Min' indicator blink, all the low alarm outputs are provided. When indication 'S.ERR' and 'Max' indicator blink, all the high alarm outputs are provided.
 - When indication '-19999' blinks, all the low alarm outputs are provided. When '19999' blinks, all the high alarm outputs are provided.
-

6.1 ALARM POINT

The alarm point, no alarm 'ALM0' or dual alarm 'ALM2', can be selected.

6.1.1 OPERATING PROCEDURE

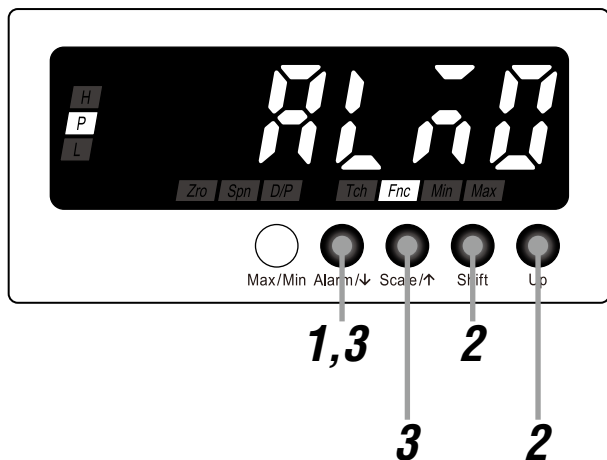

NOTE

- Procedures to change 'ALM0' to 'ALM2' are described here.
- To change 'ALM2' to 'ALM0', the procedures are same. Select 'ALM0' in Step 2.


1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'P' and 'Fnc' indicators turn on.



2 Press Shift or Up button to select 'ALM2'.

- 'H' and 'L' indicators now turn on.

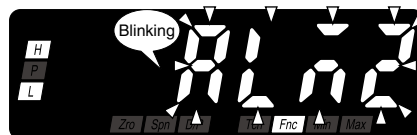

3 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the L alarm setpoint will be indicated within the range of -19999 to 19999 depending on the setting.
- Press Scale/↑ button, and the main display blinking at alarm 'B 0', 'B 1', 'B 2', 'B 3' or 'B 4' will be indicated depending on the setting.
- When "No alarm" is selected for the alarm point parameter, Alarm Setting Mode is locked.

4 ■ TO SET THE NEXT PARAMETER, Skip to Step 2 in "6.2 ALARM SETPOINT"

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

6.2 ALARM SETPOINT

Alarm setpoints can be set within the range of -19999 to 19999. However the alarm is not provided in setting the setpoint beyond the setting range of the input code. Set the setpoints within the valid range.

6.2.1 ALARM SETPOINT LIST

Default values of alarm setpoints are as shown in the following tables.


■ CURRENT INPUT

INPUT SIGNAL	DEFAULT VALUE
A: 4 – 20 mA DC	L alarm setpoint: <input type="text" value="0550"/> H alarm setpoint: <input type="text" value="1840"/>
D: 0 – 20 mA DC	L alarm setpoint: <input type="text" value="0200"/> H alarm setpoint: <input type="text" value="1800"/>

■ VOLTAGE INPUT

INPUT SIGNAL	DEFAULT VALUE
4: 0 – 10 V DC	L alarm setpoint: <input type="text" value="1000"/> H alarm setpoint: <input type="text" value="9000"/>
5: 0 – 5 V DC	L alarm setpoint: <input type="text" value="0500"/> H alarm setpoint: <input type="text" value="4500"/>
6: 1 – 5 V DC	L alarm setpoint: <input type="text" value="1400"/> H alarm setpoint: <input type="text" value="4600"/>
4W: -10 – +10 V DC	L alarm setpoint: <input type="text" value="8000"/> H alarm setpoint: <input type="text" value="8000"/>
5W: -5 – +5 V DC	L alarm setpoint: <input type="text" value="4000"/> H alarm setpoint: <input type="text" value="4000"/>

6.2.2 OPERATING PROCEDURE

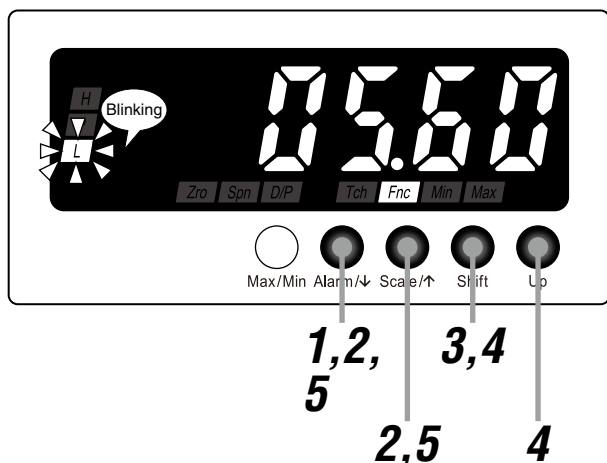


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.

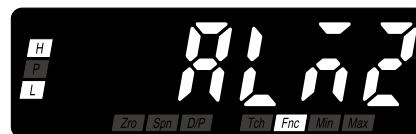

2 Press Alarm/↓ or Scale/↑ button to go to the L (H) alarm setpoint setting.

- The L (H) alarm setpoint is indicated.
- 'L' ('H') indicator blinks and 'Fnc' indicator turns on.



■ Display in setting H alarm setpoint

NOTE

The setpoint is indicated within the range of -19999 to 19999 depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The fifth digit starts blinking, to which you can apply changes.



4 Press Shift and Up buttons to set the L (H) alarm setpoint.

- Set within the range of -19999 to 19999.

IMPORTANT

Specify '----' to disable the alarm output.

NOTE

Set the alarm setpoint with the decimal point position set in the decimal point position setting.

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the L (H) trip action 'LMLO' or 'LMHI' will be indicated depending on the setting.
 - Press Scale/↑ button, and the alarm point 'ALM2' (or L coil at alarm 'RYEN' or 'RYDN') will be indicated.
-

6 ■ TO GO ON TO SET ANOTHER ALARM SETPOINT,
Repeat operation from Step 2.


- TO SET THE NEXT PARAMETER,
Skip to Step 2 in "6.3 TRIP ACTION (LO/HI)";

- TO QUIT,
Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

6.3 TRIP ACTION (LO/HI)

The trip action low 'LMLO' or high 'LMHI' can be selected. Configuring typical L/H trip setting or all trip points to high or low setting is available. The default values are "low trip" for the L trip action and "high trip" for the H.

6.3.1 OPERATING PROCEDURE

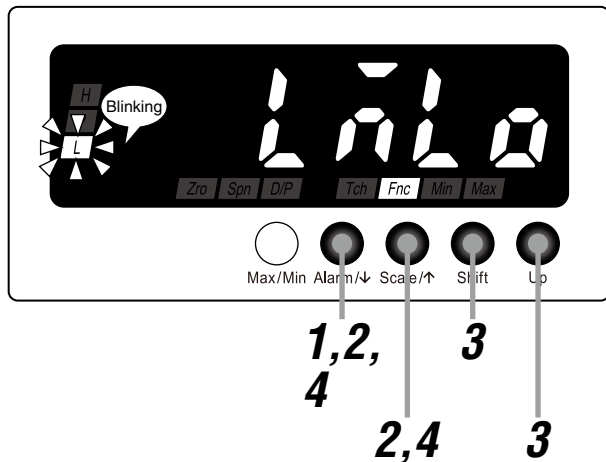

NOTE

- Procedures to change 'LMLO' to 'LMHI' are described here.
- To change 'LMHI' to 'LMLO', the procedures are the same. Select 'LMLO' in Step 3.

1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.




2 Press Alarm/↓ or Scale/↑ button to go to the L (H) trip action setting.

- 'LMLO' is indicated.
- 'L' ('H') indicator blinks and 'Fnc' indicator turns on.



■ Display in setting H trip action

3 Press Shift or Up button to select 'LMHI'.

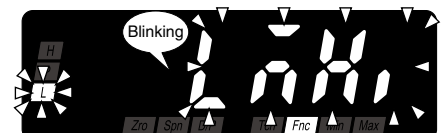

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the L (H) deadband will be indicated within the range of 0000 to 9999 depending on the setting.
 - Press Scale/↑ button, and the L (H) alarm setpoint will be indicated within the range of -19999 to 19999 depending on the setting.
-

.....

5 ■ TO GO ON TO SET ANOTHER TRIP ACTION,

Repeat operation from Step 2.

■ TO SET THE NEXT PARAMETER,

Skip to Step 2 in “6.4 DEADBAND”


■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

6.4 DEADBAND

Once a high (low) trip alarm is ON, the alarm stays ON until the data becomes lower (higher) than a certain range from the setpoint, which prevents the alarm output from chattering when the display value fluctuates slightly near the setpoint. This range is called deadband (hysteresis) and can be set within the range of 0000 to 9999. The default value is 0001.

6.4.1 OPERATING PROCEDURE

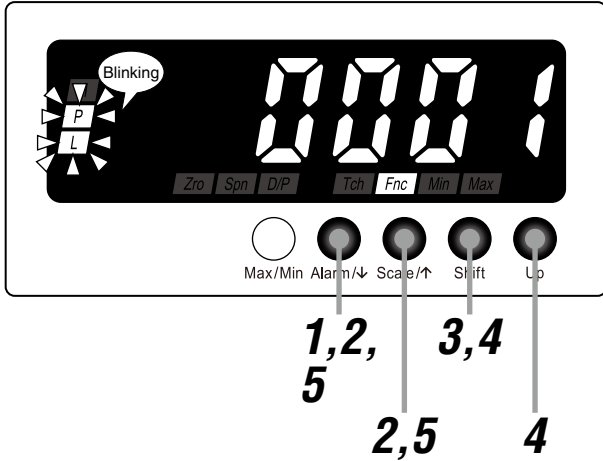

NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.



2 Press Alarm/↓ or Scale/↑ button to go to the L (H) deadband setting.

- The L (H) deadband is indicated.
- 'L' ('H') and 'P' indicators blink and 'Fnc' indicator turns on.




■ Display in setting H deadband

NOTE

The L (H) deadband is indicated within the range of 0000 to 9999 depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The forth digit starts blinking, to which you can apply changes.

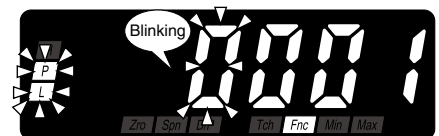

4 Press Shift and Up buttons to set the L (H) deadband.

- Set within the range of 0000 to 9999.

NOTE

Set the deadband for the setpoint. The decimal point is not indicated.

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the L (H) trip delay will be indicated within the range of 00 to 99 depending on the setting.
 - Press Scale/↑ button, and the L (H) trip action 'LMLO' or 'LMHI' will be indicated depending on the setting.
-

6 ■ TO GO ON TO SET ANOTHER DEADBAND,
Repeat operation from Step 2.


■ TO SET THE NEXT PARAMETER,
Skip to Step 2 in "6.5 TRIP DELAY".

■ TO QUIT,
Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

6.5 TRIP DELAY

Alarm output is provided when the display value exceeds the setpoint and stayed for the specified time duration, which prevents the alarm output from being provided by a sudden change such like external disturbance and starting current. This time duration is called trip delay and can be set within the range of 0 to 99 seconds. The default value is 0 second.

6.5.1 OPERATING PROCEDURE

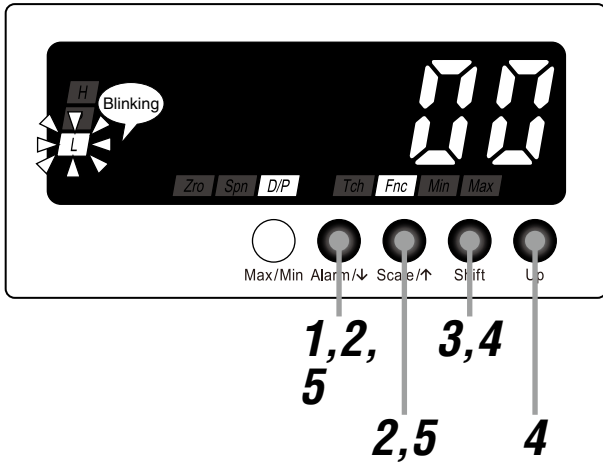

NOTE

The following figures are display examples. The displays depend on the settings.

 

1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.



2 Press Alarm/↓ or Scale/↑ button to go to the L (H) trip delay setting.

- The L (H) trip delay is indicated.
- 'L' ('H') indicator blinks, 'D/P' and 'Fnc' indicators turn on.

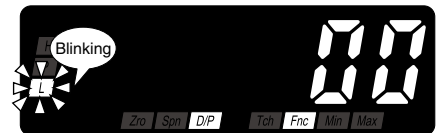


■ Display in setting H trip delay

NOTE

The trip delay is indicated within the range of 00 to 99 depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The second digit starts blinking, to which you can apply changes.

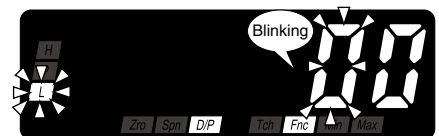

.....

4 Press Shift and Up buttons to set the L (H) trip delay.

- Set within the range of 00 to 99.

.....

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the L (H) coil at alarm 'RYEN' or 'RYDN' will be indicated depending on the setting.
 - Press Scale/↑ button, and the L (H) deadband will be indicated within the range of 0000 to 9999 depending on the setting.
-

.....

6 ■ TO GO ON TO SET ANOTHER TRIP DELAY,
Repeat operation from Step 2.

■ TO SET THE NEXT PARAMETER,

Skip to Step 2 in "6.6 ALARM OUTPUT LOGIC (coil energized or de-energized at alarm)"


■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

6.6 ALARM OUTPUT LOGIC (coil energized or de-energized at alarm)

Alarm output logic can be selected. This parameter is called energizing direction and coil energized 'RYEN' or de-energized 'RYDN' at alarm can be selected. In selecting coil de-energized at alarm, the alarm output logic is inverted. The default setting is coil energized.

6.6.1 OPERATING PROCEDURE

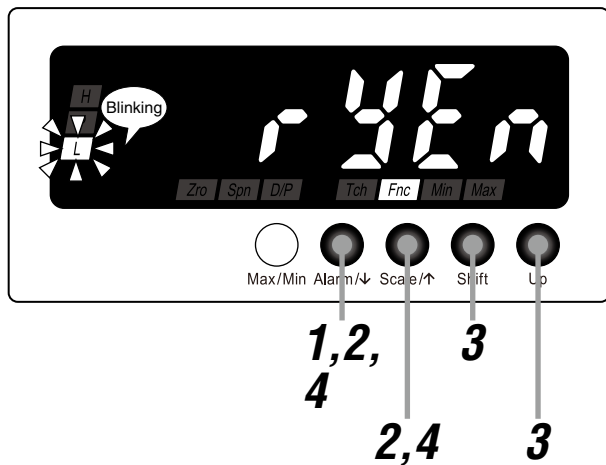

NOTE

- Procedures to change 'RYEN' to 'RYDN' are described here.
- To change 'RYDN' to 'RYEN', the procedures are same. Select 'RYEN' in Step 3.


1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.




2 Press Alarm/↓ or Scale/↑ button to go to the setting of the L (H) coil at alarm.

- 'RYEN' is indicated.
- 'L' ('H') indicator blinks and 'Fnc' indicator turns on.

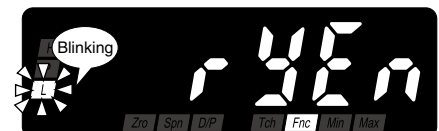

■ Display in setting H coil at alarm

3 Press Shift or Up button to select 'RYDN'.

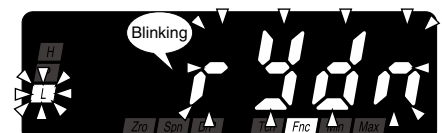

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the H alarm setpoint (or main display blinking at alarm) will be indicated within the range of -19999 to 19999 (or 'B 0', 'B 1', 'B 2', 'B 3' or 'B 4') depending on the setting.
 - Press Scale/↑ button, and the L (H) trip delay will be indicated within the range of 00 to 99 depending on the setting.
-

.....

5 ■ TO GO ON TO SET ANOTHER COIL AT ALARM,
Repeat operation from Step 2.

■ TO SET THE NEXT PARAMETER,

Skip to Step 2 in "6.7 MAIN DISPLAY BLINKING AT ALARM".

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.


6.7 MAIN DISPLAY BLINKING AT ALARM

Main display blinking interval at alarm can be specified. The interval can be selected among those shown in the following table.

■ BLINKING INTERVAL AT ALARM

DISPLAY	FUNCTION	DEFAULT VALUE
	No blinking	
	Blinking in 1.0 second intervals	
	Blinking in 0.5 second intervals	
	Blinking in 0.2 second intervals	
	Blinking in 0.1 second intervals	

6.7.1 OPERATING PROCEDURE

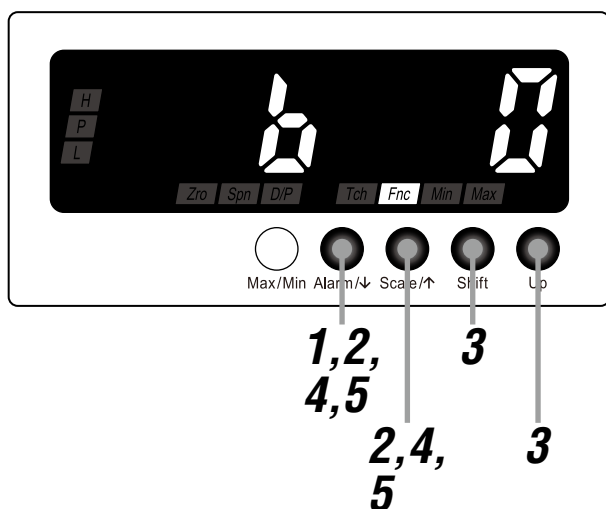


NOTE

The following figures are display examples. The displays depend on the settings.


1 Hold down Alarm/↓ button for 3 seconds or more to move on to Alarm Setting Mode.

- The alarm point is indicated.
- 'H', 'L' and 'Fnc' indicators turn on.

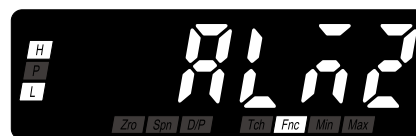

2 Press Alarm/↓ or Scale/↑ button to go to the setting of the main display blinking at alarm.

- The main display blinking at alarm is indicated.
- 'Fnc' indicator turns on.

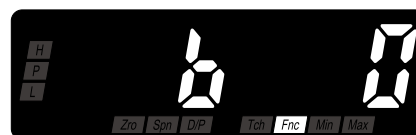


NOTE

'B 0', 'B 1', 'B 2', 'B 3' or 'B 4' is indicated depending on the setting.

.....

3 Press Shift or Up button to select.

- Select one among 'B 0', 'B 1', 'B 2', 'B 3' and 'B 4'.

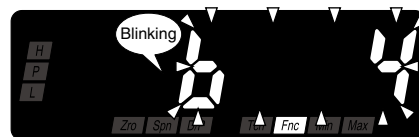

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the alarm point 'ALM2' will be indicated.
 - Press Scale/↑ button, and the H coil at alarm 'RYEN' or 'RYDN' will be indicated depending on the setting.
-

.....

5 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.


7. AVERAGING INPUT

Moving average processing of measured values is configurable. The number of samples in processing the moving average can be selected in the following table. This operation averages sampled values, and then, averages with a new sample added and the oldest one omitted. Such operation is repeated as shown in the following figure. For instance, when 'A 4' is selected, the moving average processing with 4 samples (100 millisecond intervals) is repeated. Moving average is used to remove periodic varied noise superimposed on the input signal and suppress the display flickering.

■ NUMBER OF SAMPLES


DISPLAY	FUNCTION	DEFAULT VALUE
OFF	No moving averaging	A 4
A 2	Moving average with 2 samples (50 millisecond intervals)	
A 4	Moving average with 4 samples (100 millisecond intervals)	
A 8	Moving average with 8 samples (200 millisecond intervals)	
A 16	Moving average with 16 samples (400 millisecond intervals)	
A 32	Moving average with 32 samples (800 millisecond intervals)	
A 64	Moving average with 64 samples (1.6 second intervals)	

■ EXAMPLE OF MOVING AVERAGE WITH 4 SAMPLES

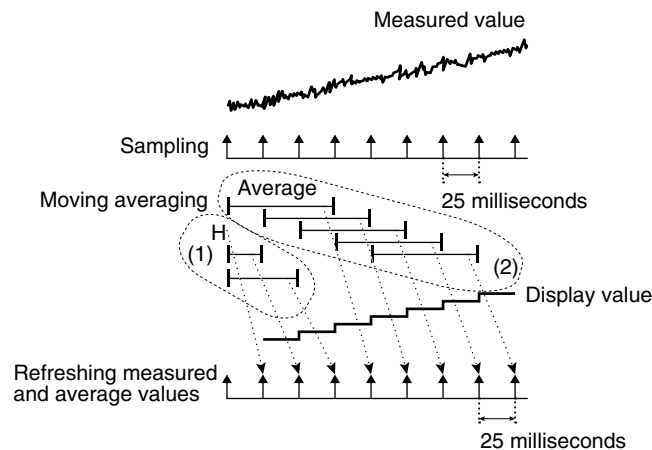

- (1) The moving average operation starts immediately after the power is on or the moving average is set. Until the sampling No. reaches the set value, all samples are averaged every 25 milliseconds.
- (2) After the sampling No. reaches the set value, a new sample is added to be averaged with the oldest one omitted. Such operation is repeated.

7.1 OPERATING PROCEDURE

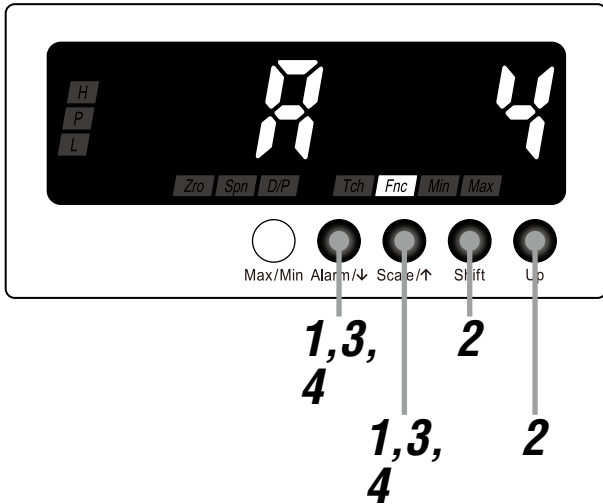


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

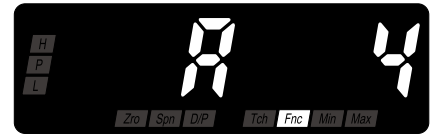


NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Shift or Up button to select.

- Select one among 'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' and 'A 64'.

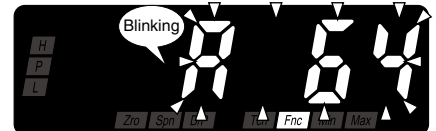

3 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the low-end cutout 'Z OFF' or 'Z ON' will be indicated depending on the setting.
- Press Scale/↑ button, and the version indication will be indicated.

4 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

8. ELIMINATING FLUCTUATION AROUND “0”

A measured value less than the preset cutout value can be forcibly cut to 0 (figure below). This parameter is called low-end cutout and the value is called low-end cutout value. Enable the low-end cutout first (table below) and set the low-end cutout value within the range of 000 to 999. The low-end cutout is effective to eliminate slippage or fluctuation of the display values near zero.


■ LOW-END CUTOUT

DISPLAY	FUNCTION	DEFAULT VALUE
off	Low-end cutout OFF	off
on	Low-end cutout ON	

■ SETTING RANGE

Set the low-end cutout value for the three lowest digits of the display scaling value within the range of 000 to 999. The default value is 000.

■ DISPLAY EXAMPLE WITH LOW-END CUTOUT ON

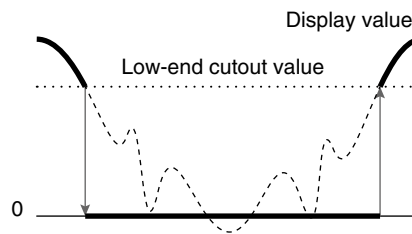


Fluctuation near 0 and negative reading can be cut to 0.

NOTE

Set the display scaling ZERO to 0 when the low-end cutout is set to ON. Otherwise with the display scaling ± 1000 and the low-end cutout value 50, for example, the indication with the scaling value -1000 to 49 will be cut to 0.

8.1 LOW-END CUTOUT

8.1.1 OPERATING PROCEDURE

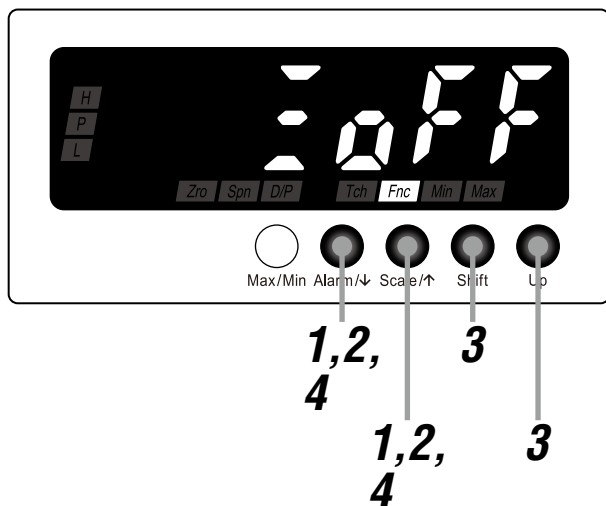


NOTE

- Procedures to change 'ZOFF' to 'Z ON' are described here.
- To change 'Z ON' to 'ZOFF', the procedures are same. Select 'ZOFF' in Step 3.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

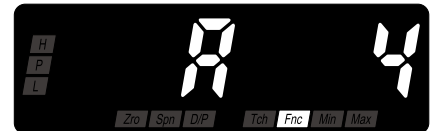

NOTE


'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the low-end cutout setting.

- 'ZOFF' is indicated.
- 'Fnc' indicator turns on.



3 Press Shift or Up button to select 'Z ON'.

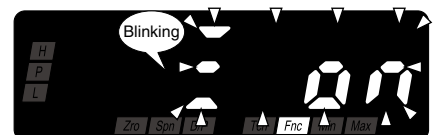

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the low-end cutout value will be indicated within the range of 'Z000' to 'Z999' depending on the setting. When low-end cutout OFF is selected, the brightness 'C 1', 'C 2', 'C 3', 'C 4' or 'C 5' will be indicated depending on the setting.
 - Press Scale/↑ button, and the moving average sampling No. 'AOFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' will be indicated depending on the setting.
-

.....


5 ■ TO GO ON TO SET THE LOW-END CUTOUT VALUE,
Skip to Step 2 in "8.2 LOW-END CUTOUT VALUE."

■ TO QUIT,

Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

8.2 LOW-END CUTOUT VALUE

8.2.1 OPERATING PROCEDURE

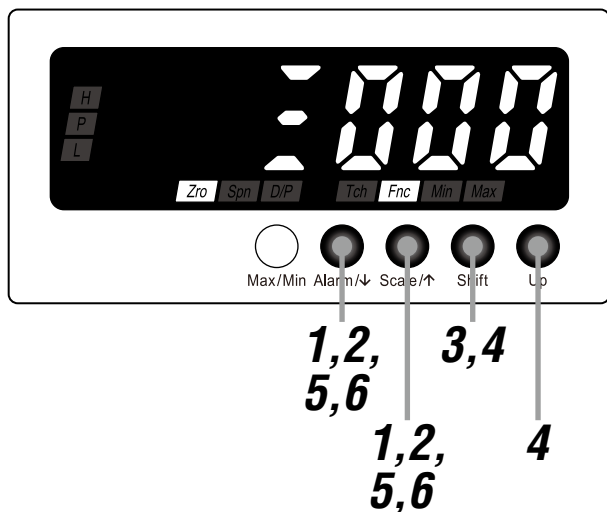


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

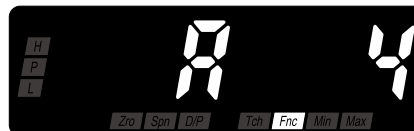


NOTE

'A0FF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the low-end cutout value setting.

- The low-end cutout value is indicated.
- 'Zro' and 'Fnc' indicators turn on.

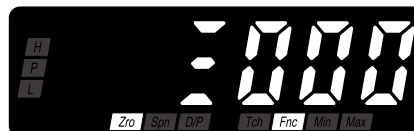


NOTE

The low-end cutout value is indicated within the range of 'Z000' to 'Z999' depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The third digit starts blinking, to which you can apply changes.

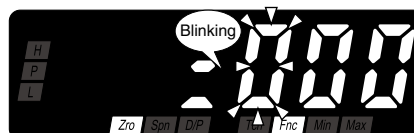

.....

4 Press Shift and Up buttons to set the low-end cutout value.

- Set within the range of 'Z000' to 'Z999'.

NOTE

Set the value for the display scaling. The decimal point is not indicated.

.....

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the brightness 'C 1', 'C 2', 'C 3', 'C 4' or 'C 5' will be indicated depending on the setting.
 - Press Scale/↑ button, and the low-end cutout 'Z ON' will be indicated.
-

.....

6 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.


9. ADJUSTING BRIGHTNESS OF DISPLAY

The brightness of the display can be adjusted (figures below). The brightness can be selected in the following table.


■ DISPLAY BRIGHTNESS

DISPLAY	FUNCTION	DEFAULT VALUE
	Brightness level 1 (dark)	
	Brightness level 2	
	Brightness level 3	
	Brightness level 4	
	Brightness level 5 (bright)	

■ ADJUSTMENT IMAGE

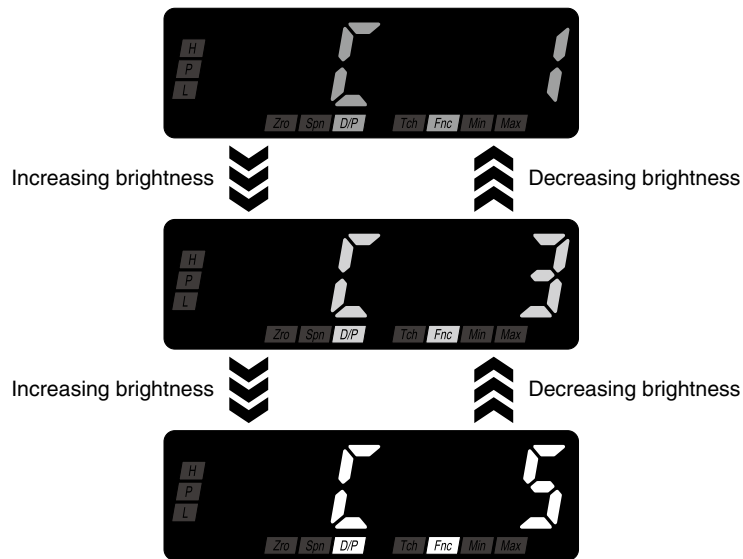

9.1 OPERATING PROCEDURE

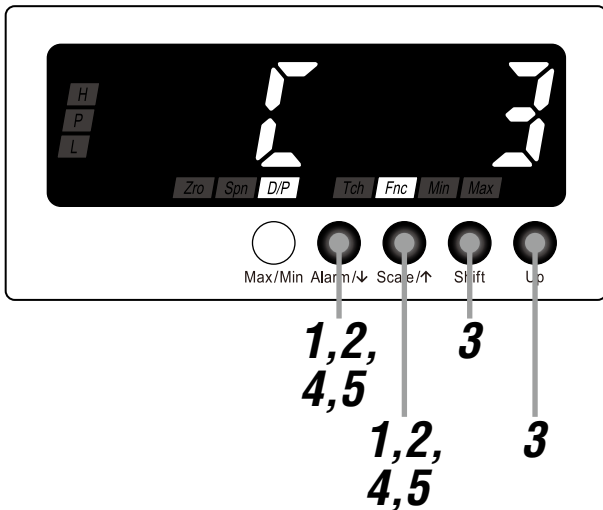

NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.




NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the brightness setting.

- The brightness is indicated.
- 'D/P' and 'Fnc' indicators turn on.

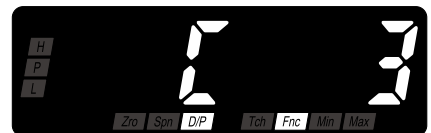


NOTE

'C 1', 'C 2', 'C 3', 'C 4' or 'C 5' is indicated depending on the setting.

3 Press Shift or Up button to select.

- Select one among 'C 1', 'C 2', 'C 3', 'C 4' and 'C 5'.

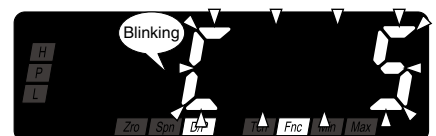

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the setting time out will be indicated within the range of 'R 00' to 'R 99' depending on the setting.
 - Press Scale/↑ button, and the low-end cutout value will be indicated within the range of 'Z000' to 'Z999' depending on the setting. The low-end cutout 'ZOFF' will be indicated with the cutout set to OFF.
-

.....

5 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

10. GOING BACK AUTOMATICALLY TO MEASURING MODE

The display goes back automatically to Measuring Mode if the front buttons are left untouched for the specified time period while it is in one of the setting modes. This time period is called setting time out and can be set within the range of 1 to 99 seconds (Table 1). With the value set to 'R 00', the display must always be exited manually from the setting mode. The display does not go back automatically to Measuring Mode depending on the modes (Table 2).


■ TABLE 1: SETTING TIME OUT

DISPLAY	FUNCTION	DEFAULT VALUE
r 00	Setting time out disabled	r 60
r 01 to r 99	1 to 99 seconds	

■ TABLE 2: SETTING TIME OUT IN EACH MODE

MODE	OPERATION	SETTING TIME OUT
Measuring Mode	Confirming alarm setpoint	Enabled
	Displaying MAX or MIN value	Disabled
	Executing Forced Zero	Disabled
Scaling Setting Mode		Enabled
Alarm Setting Mode		Enabled
Advanced Setting Mode		Enabled
Lockout Setting Mode		Enabled

10.1 OPERATING PROCEDURE

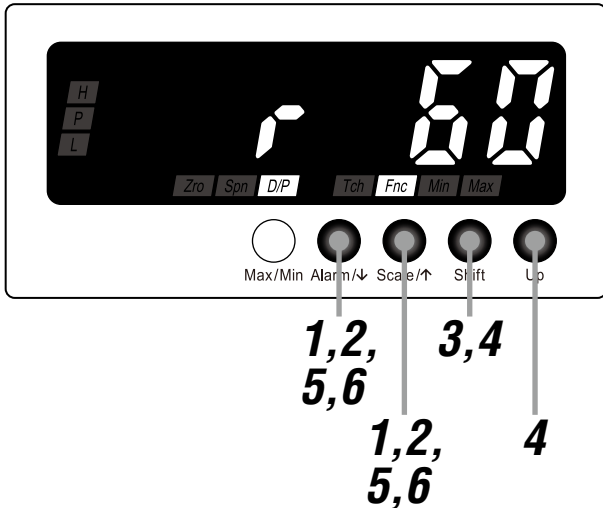


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

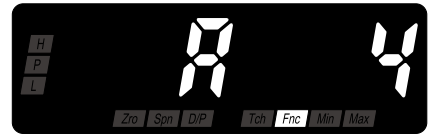


NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the setting time out setting.

- The setting time out is indicated.
- 'D/P' and 'Fnc' indicators turn on.

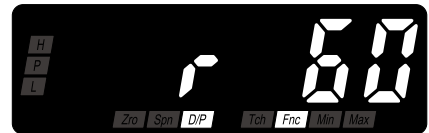


NOTE

The setting time out is indicated within the range of 'R 00' to 'R 99' depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The second digit starts blinking, to which you can apply changes.

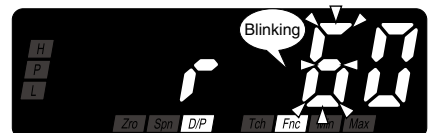

4 Press Shift and Up buttons to set the setting time out.

- Set within the range of 'R 00' to 'R 99'

.....

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the transition time to Lockout Setting Mode will be indicated within the range of 'P 00' to 'P 99' depending on the setting.
 - Press Scale/↑ button, and the brightness 'C 1', 'C 2', 'C 3', 'C 4' or 'C 5' will be indicated depending on the setting.
-

.....

6 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

11. ADJUSTING DISPLAY REFRESHING RATE


The display refreshing rate can be set within the range of 0.1 to 99.9 seconds. With this value set to 00.0, the refreshing rate will be 50 milliseconds (table below). When the input signal changes rapidly, the display refreshing rate can be slowed to suppress the display flickering.

■ DISPLAY REFRESHING RATE


DISPLAY	FUNCTION	DEFAULT VALUE
<code>F000</code>	50 milliseconds	<code>F000</code>
<code>F00.1</code> to <code>F99.9</code>	0.1 to 99.9 seconds	

■ DISPLAY REFRESHING IMAGE

e.g. Refreshing rate 0.2 seconds

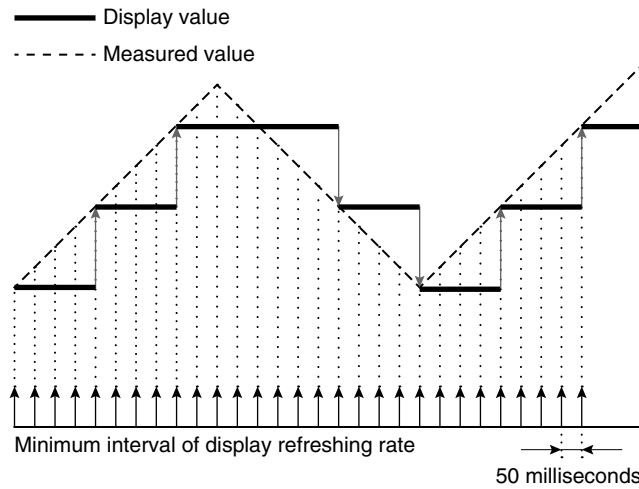

11.1 OPERATING PROCEDURE

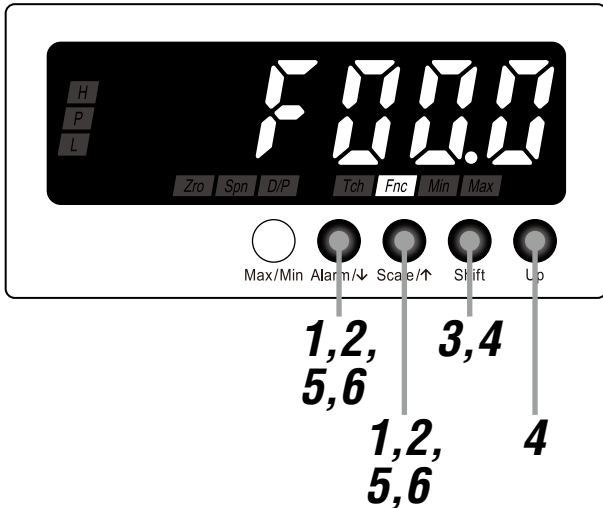


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

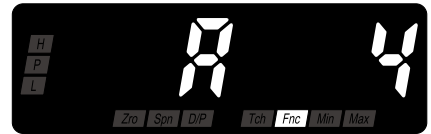

NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the display refreshing rate setting.

- The display refreshing rate is indicated.
- 'Fnc' indicator turns on.




NOTE

The display refreshing rate is indicated within the range of 'F00.0' to 'F99.9' depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The third digit starts blinking, to which you can apply changes.

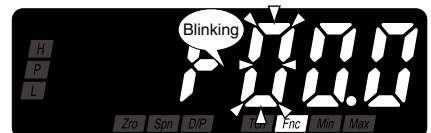

4 Press Shift and Up buttons to set the display refreshing rate.

- Set within the range of 'F00.0' to 'F99.9'.

.....

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the version indication will be indicated.
 - Press Scale/↑ button, and the transition time to Lockout Setting Mode will be indicated within the range of 'P 00' to 'P 99' depending on the setting.
-

.....

6 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

12. USEFUL FUNCTIONS


12.1 CONFIRMING ALARM SETPOINTS

The alarm setpoints set in Alarm Setting Mode can be confirmed while in Measuring Mode.

Each time pressing Alarm/↓ button during Measuring Mode, the indication is switched in the order of L alarm setpoint to H alarm setpoint and back to original indication.

■ PROCEDURE TO CONFIRM ALARM SETPOINTS

Each time pressing Alarm/↓ button in Measuring Mode, the indication is changed from the present value to L alarm setpoint to H alarm setpoint and back to present value.

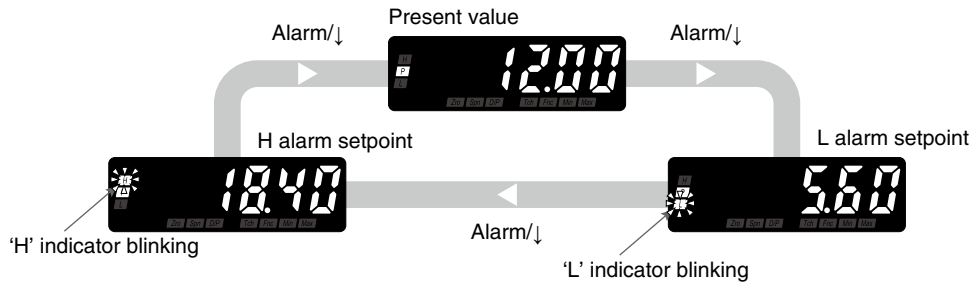

*1 Display depends on the specifications, settings and input.

NOTE


- When “No alarm” is selected for the alarm point parameter in Alarm Setting Mode, alarm setpoints cannot be confirmed.
- The alarm setpoints can be confirmed even when MAX or MIN value is indicated. After confirmation, the indication will be back to MAX or MIN value.
- The alarm setpoints can be confirmed while in Forced Zero mode. After confirmation, the indication will be back to the display value after Forced Zero.
- The alarm setpoints cannot be confirmed while ‘S.ERR’ is indicated. Increase or decrease the input signal within the measurable range and then confirm the setpoints.

12.2 FORCING THE PRESENT DISPLAY VALUE TO ZERO

The display value can be forced to 0 while in Measuring Mode. Press Up button during Measuring Mode to shift the present display value to zero and to continue measuring in reference to this point. This operation is called Forced Zero. This function can be used for applications such as measuring the weight of the contents in a container by canceling the weight of the empty container, or indicating the weight of each material adding into a container one after another.

■ DISPLAY VALUE IN EXECUTING AND CANCELING FORCED ZERO


The display value changes as shown in the following figure when Forced Zero is executed or canceled while in measuring.

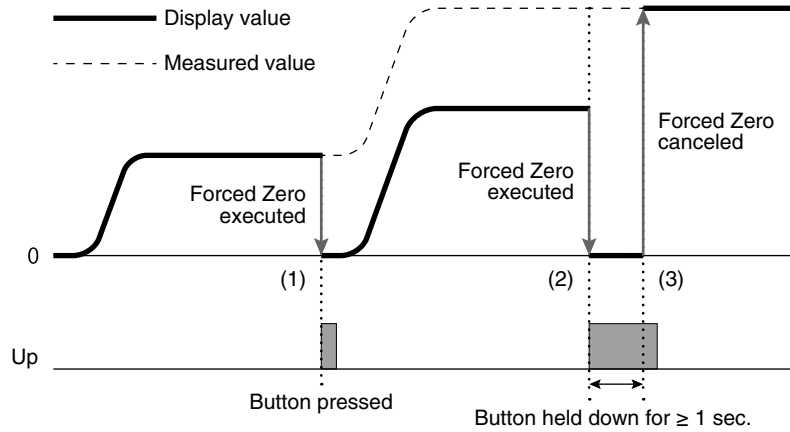

- (1) Press Up button to shift the present display value to zero.
- (2) Press Up button again for 1 second or more to cancel the Forced Zero mode. The display value is forced to 0 once.
- (3) Then the display is back to indicate the measured value.

■ OPERATING PROCEDURE TO EXECUTE/CANCEL FORCED ZERO

- (1) Press Up button in Measuring Mode to execute the Forced Zero.
- (2) Hold down Up button for 1 second or more to cancel the Forced Zero mode.

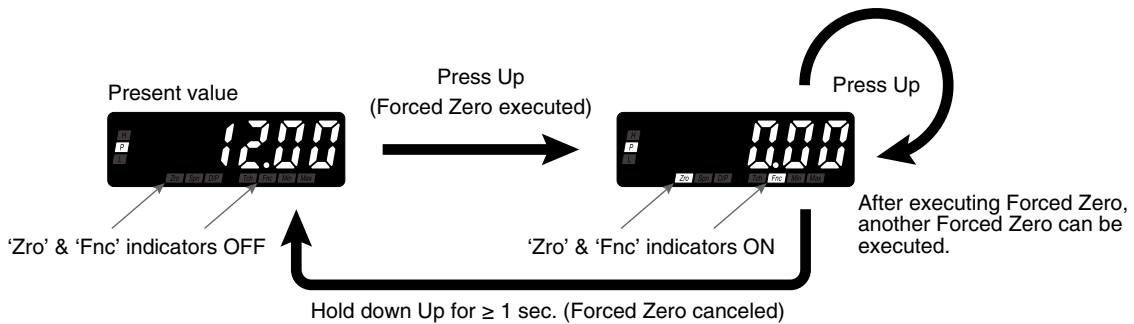

*1 Display depends on the specifications, settings and input.

NOTE


- Forced Zero cannot be executed or canceled while in the MAX/MIN Value Display mode.
- Forced Zero value is stored in memory even when the power is removed.
- Forced Zero cannot be executed or canceled while 'S.ERR' is indicated. Increase or decrease the input signal within the measurable range and then execute the Forced Zero again.

12.3 RETAINING MAX AND MIN VALUES

MAX and MIN values can be confirmed while in Measuring Mode. Each time pressing Max/Min button during Measuring Mode, the indication is switched in the order of MAX value to MIN value and back to original indication.

■ MAX AND MIN VALUES


MAX and MIN values are updated while in measuring.

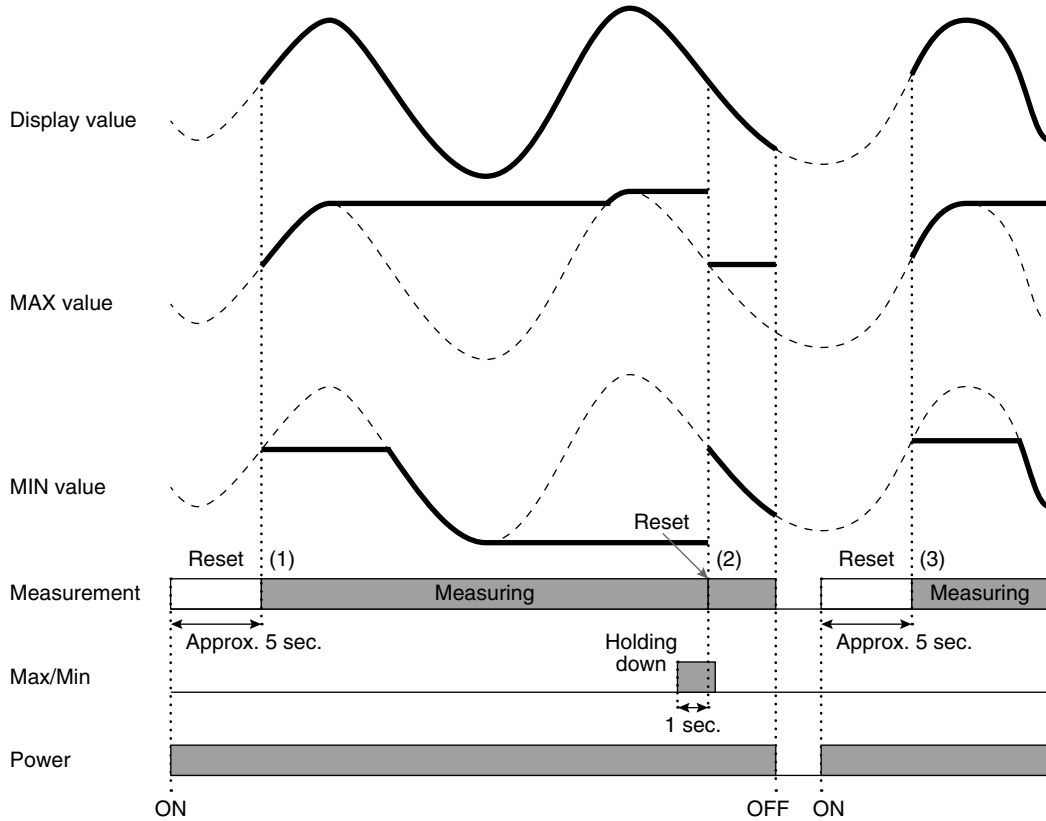

- (1) The internal memory is reset for approx. 5 seconds after the power is on, and the unit starts to measure MAX and MIN values.
- (2) Hold down Max/Min button for 1 second or more to reset the MAX and MIN values and then the unit starts to measure MAX and MIN values again.
- (3) The internal memory is reset for approx. 5 seconds after the power is off and on again, and then the unit starts to measure MAX and MIN values again.

■ PROCEDURE TO CONFIRM MAX OR MIN VALUE

- (1) Each time pressing Max/Min button during Measuring Mode, the indication is changed from the present value to MAX value, MIN value, and back to present value.
- (2) Hold down Max/Min button for 1 second or more to reset the MAX and MIN values and indicate new MAX and MIN values. The MAX and MIN values are reset when the power is turned off.

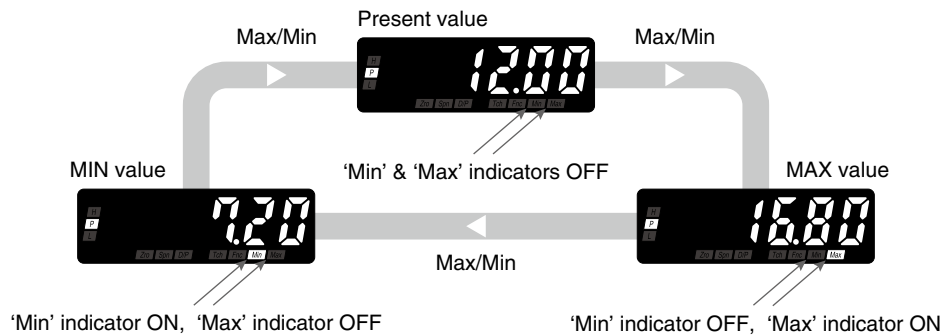

*1 Display depends on the specifications, settings and input.

NOTE

- The MAX and MIN values are not reset even when the Forced Zero is executed or canceled.
- Pressing Max/Min button while in confirming the alarm setpoints switches the indication to MAX or MIN value.
- MAX and MIN values are not indicated while 'S.ERR' is indicated. Increase or decrease the input signal within the measurable range and then press Max/Min button again.

12.4 LIMITING BUTTON OPERATION


Transition from Measuring Mode to each setting mode can be limited. With this setting, the transition to each mode by holding down the buttons will be disabled. In Lockout Setting Mode, the lockout per mode is selectable.

■ LOCKOUT SETTING

Following 4 lockout settings are available.

PARAMETER	INDICATORS	DISPLAY	FUNCTION	DEFAULT VALUE
Alarm setting lockout	D/P, Fnc	RoFF	Unlock Alarm Setting Mode	RoFF
		R on	Lock Alarm Setting Mode	
Scaling setting lockout		S oFF	Unlock Scaling Setting Mode	S oFF
		S on	Lock Scaling Setting Mode	
Advanced setting lockout		doFF	Unlock Advanced Setting Mode	doFF
	d on	Lock Advanced Setting Mode		
Forced zero lockout	z oFF	Unlock (Enable) Forced Zero operation	z on	
	z on	Lock (Disable) Forced Zero operation		

12.4.1 OPERATING PROCEDURE

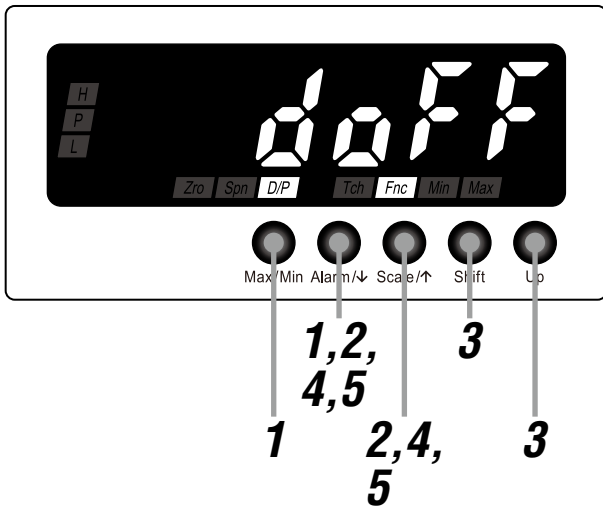


NOTE

- Procedures to lock the advanced setting mode are described here. The procedures to lock other setting modes are same. Select your desired mode to lock in Step 2.
- To cancel the limitation, select 'xOFF' in Step 3.

1 Hold down Max/Min and Alarm/↓ buttons at once for a preset time duration to move on to Lockout Setting Mode.

- The alarm setting lockout is indicated.
- 'D/P' and 'Fnc' indicators turn on.

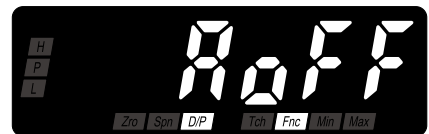


NOTE

'AOFF' or 'A ON' is indicated depending on the setting.


2 Press Alarm/↓ or Scale/↑ button to go to the advanced setting lockout setting.

- 'DOFF' is indicated.
- 'D/P' and 'Fnc' indicators turn on.

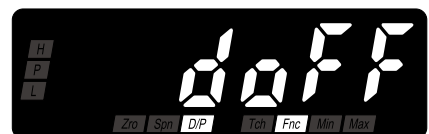

.....

3 Press Shift or Up button to select 'D ON'.

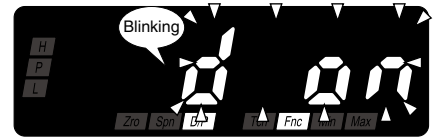

.....

4 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the forced zero lockout 'ZOFF' or 'Z ON' will be indicated depending on the setting.
 - Press Scale/↑ button, and the scaling setting lockout 'SOFF' or 'S ON' will be indicated depending on the setting.
-


.....

5 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

12.5 TRANSITION TIME TO LOCKOUT SETTING MODE

Time duration to hold down the buttons for transition to Lockout Setting Mode can be set within the range of 0 to 99 seconds. The default value is 5 seconds.

12.5.1 OPERATING PROCEDURE

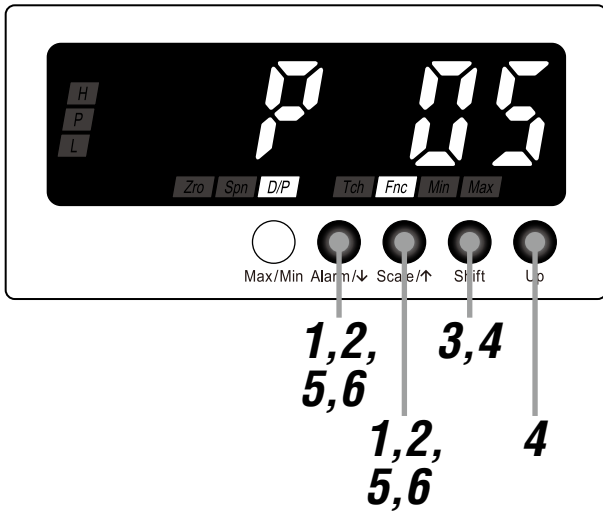


NOTE

The following figures are display examples. The displays depend on the settings.

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

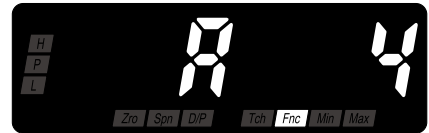


NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the setting of the transition time to Lockout Setting Mode.

- The transition time to Lockout Setting Mode is indicated.
- 'D/P' and 'Fnc' indicators turn on.

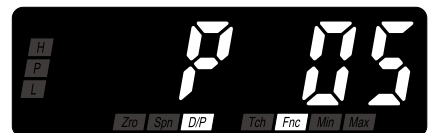


NOTE

The transition time is indicated within the range of 'P 00' to 'P 99' depending on the setting.

3 Press Shift button to shift the display into the setting standby mode.

- The second digit starts blinking, to which you can apply changes.

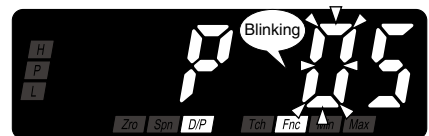

.....

4 Press Shift and Up buttons to set the transition time to Lockout Setting Mode.

- Set within the range of 'P 00' to 'P 99'.

.....

5 Press Alarm/↓ or Scale/↑ button to apply the new setting.

- And the next parameter setting is indicated.

NOTE

- Press Alarm/↓ button, and the display refreshing rate will be indicated within the range of 'F00.0' to 'F99.9' depending on the setting.
 - Press Scale/↑ button, and the setting time out will be indicated within the range of 'R 00' to 'R 99' depending on the setting.
-

.....

6 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

13. USER CALIBRATION


User calibration is calibration by a customer using customer’s measuring instruments and standards. To calibrate (adjust) the input signal, use “Teach Calibration” function. The unit is calibrated correctly at shipment and therefore there is normally no need for customers to calibrate it.

13.1 TEACH CALIBRATION

You can calibrate the input signal by the Teach Calibration function if you need calibration. Input scaling ZERO and SPAN can be adjusted by applying actual input signals. Please note that we do not warrant the result of your own calibration (adjustment). The internal calibration data is overwritten every time the unit is calibrated and it is stored even if the power is turned off. However the data will be lost after an initialization. Prepare measuring instruments and equipment for calibration by yourselves. Refer to each manual carefully for the instruments and equipment for information on handling them.

13.1.1 TEACH CALIBRATION FLOW


The Teach Calibration is carried out as shown in the following flowchart.

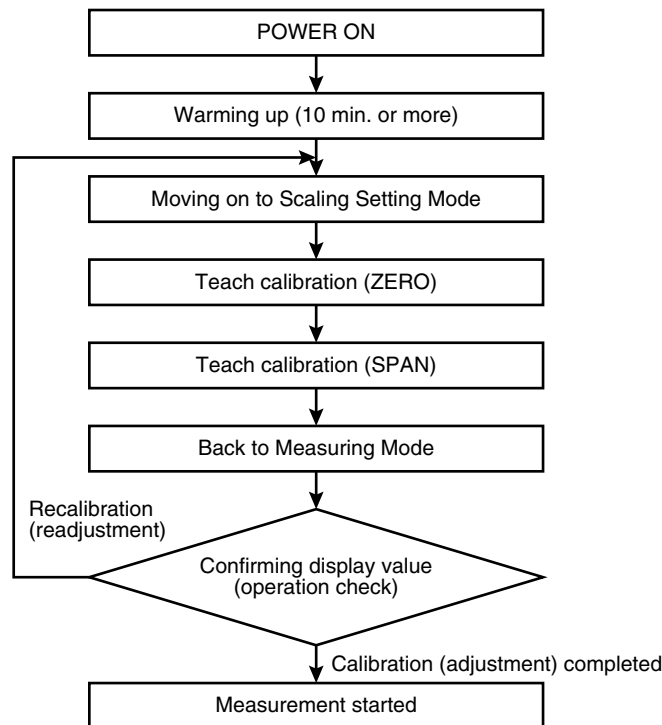

IMPORTANT

- Warm up measuring instruments, equipment and other devices on site for the time specified in each manual, and operate the unit in a stable condition.
- In setting the input scaling ZERO and SPAN using actual inputs, carry out the Teach Calibration within the setting range per input code. Do not set 'input scaling ZERO ≥ input scaling SPAN' in carrying out the Teach Calibration.

13.1.2 OPERATING PROCEDURE

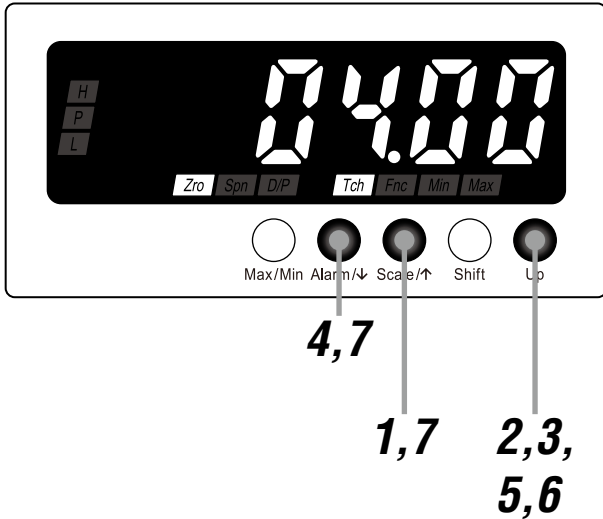

NOTE

The following figures are display examples. The displays depend on the specifications and settings.

1 Hold down Scale/↑ button for 3 seconds or more to move on to Scaling Setting Mode.

- The input scaling ZERO is indicated.
- 'Zro' and 'Tch' indicators turn on.



IMPORTANT


Warm up the unit for 10 minutes or more before carrying out the Teach Calibration.

NOTE

Skip to Step 4 when the teach calibration (ZERO) is not necessary.

2 Press Up button to go to the teach calibration (ZERO) setting.

- The present input is indicated.
- 'Tch' indicator starts blinking.

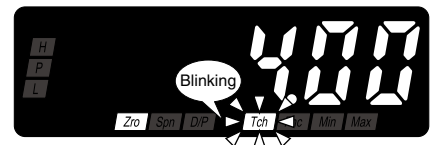

3 Apply 0% input and press Up button to register the value.

- The teach calibration (ZERO) is registered.
- 'Tch' indicator turns ON.




IMPORTANT

Confirm that the input signal is stable before pressing Up button.

4 Press Alarm/↓ button twice to go to the input scaling SPAN setting.

- The input scaling SPAN is indicated.
- 'Spn' and 'Tch' indicators turn on.

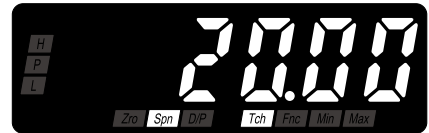


NOTE

Skip to Step 7 when the teach calibration (SPAN) is not necessary.


5 Press Up button to go to the teach calibration (SPAN) setting.

- The present input is indicated.
- 'Tch' indicator starts blinking.

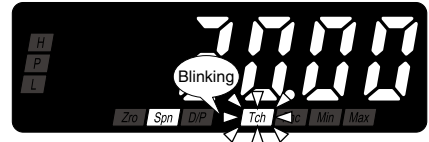

6 Apply 100% input and press Up button to register the value.

- The teach calibration (SPAN) is registered.
- 'Tch' indicator turns ON.

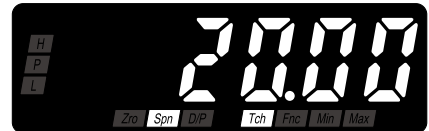

IMPORTANT

Confirm that the input signal is stable before pressing Up button.

7 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

14. INSPECTION / CLEANING

To use the unit in the normal and best conditions, inspect and clean the unit routinely or periodically.

- When the display and the buttons have dirt, wipe them with wet soft cloth. Do not use organic solvent such like benzine, thinner and alcohol. Doing so may result in deformation or discoloration of the unit.
- Make sure that abnormality such like smokes, unusual smell or abnormal noises is not found. Using the unit continuously with such abnormality may result in a fire or electric shock.
- Check the terminal screws periodically. In checking the screws, for safety, interrupt electricity to the power, input and alarm output.
- Check the connector periodically. In checking the connector, for safety, interrupt electricity to the power, input and alarm output.
- Make sure periodically that the screws are fixed tightly. Loosened screws may cause drop of the unit.

15. TROUBLESHOOTING

15.1 ERROR MESSAGES

MAIN DISPLAY	ERROR MESSAGE	WHAT TO DO
SErr	Input error, Out of the measurable range	Increase/decrease the input signal until it is back within the measurable range.
RErr	Non-volatile memory error (reading)	Initialize the unit to its factory default status at the lockout setting mode.*1
WErr	Non-volatile memory error (writing)	
IErr	Internal data error	Repair is needed if the display does not recover after the power is reset.

*1 If the unit does not recover its function after the initialization, repairing in the factory may be required.


15.2 INITIALIZING SETTING VALUES

To restart setting from the default state, initialization can be used. Refer to attached 16.3 PARAMETER LIST for the default values.

IMPORTANT

- Currently set parameters will be lost after an initialization. It is recommended to record the parameters before initialization.
- Even if the unit is shipped with the specified parameters with the option code '/SET', such parameters will be lost after an initialization. Be careful that the initialization does not recover the ex-factory settings.

15.2.1 OPERATING PROCEDURE

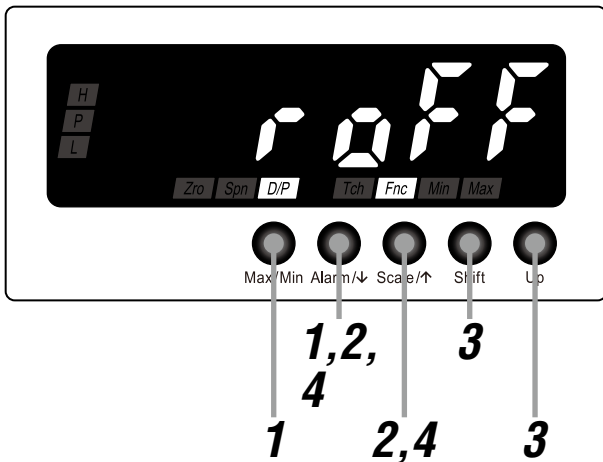

1 Hold down Max/Min and Alarm/↓ buttons at once for a preset time duration to move on to Lockout Setting Mode.

- The alarm setting lockout is indicated.
- 'D/P' and 'Fnc' indicators turn on.



NOTE


'A OFF' or 'A ON' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the initialization.

- 'ROFF' is indicated.
- 'D/P' and 'Fnc' indicators turn on.



3 Press Shift or Up button to select 'RST'.

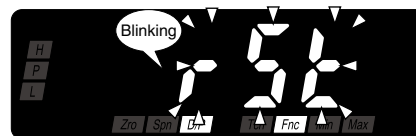

4 Press Alarm/↓ or Scale/↑ button to execute the initialization.

- The initialization will be completed in approx. 3 seconds and the display will return to Measuring Mode.


15.3 CONFIRMING FIRMWARE VERSION

The firmware version of the unit can be confirmed.

Confirm the version in the following cases:


- The display is different from the one described in the operating manual.
- The firmware version is necessary to consult us for troubles.

15.3.1 OPERATING PROCEDURE

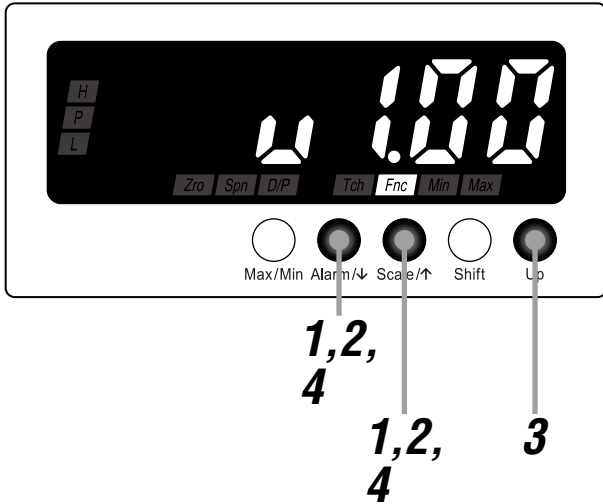

1 Hold down Alarm/↓ and Scale/↑ buttons at once for 3 seconds or more to move on to Advanced Setting Mode.

- The moving average sampling No. is indicated.
- 'Fnc' indicator turns on.

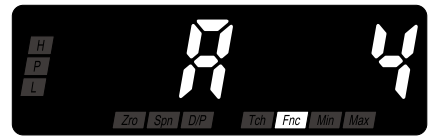


NOTE

'A OFF', 'A 2', 'A 4', 'A 8', 'A 16', 'A 32' or 'A 64' is indicated depending on the setting.

2 Press Alarm/↓ or Scale/↑ button to go to the version indication.

- The first half of the firmware version number is indicated.
- 'Fnc' indicator turns on.

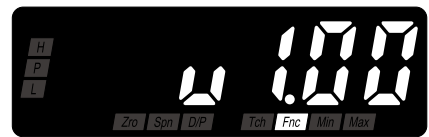

3 Press Up button to indicate another 4 digits of the version number.



NOTE

- The above figures show the firmware version V1.00.0017.
- The displays depend on the firmware version number.

4 Hold down Alarm/↓ or Scale/↑ button for 3 seconds or more to return to Measuring Mode.

16. APPENDICES

16.1 SPECIFICATIONS

■ GENERAL SPECIFICATIONS

Construction		Panel mount type
Degree of protection		IP66; Applicable to the front of the panel meter mounted according to the specified panel cutout.
Connection		M3 screw terminals (torque 0.6 N·m)
Screw terminal		Nickel-plated steel
Housing material		Flame-resistant (gray)
Isolation		Input to alarm output to power
Setting (front button)	Scaling setting mode	Input scaling ZERO/SPAN, display scaling ZERO/SPAN, decimal point position
	Alarm setting mode	Alarm point, H/L alarm setpoint, H/L trip action, H/L deadband (hysteresis), H/L trip delay, H/L coil at alarm, main display blinking at alarm
	Advanced setting mode	Moving average, low-end cutout, low-end cutout value, brightness, setting time out, transition time to Lockout Setting Mode, display refreshing rate, version indication
	Lockout setting mode	Alarm setting lockout, scaling setting lockout, advanced setting lockout, forced zero lockout, initialization
Averaging		None or moving average
Lockout setting		Prohibiting certain operations; protecting settings

■ DISPLAY

Display		16 mm (.63) high, 4 ½ digits, 7-segment LED
Display range		-19999 to 19999
Decimal point position		10 ⁻¹ , 10 ⁻² , 10 ⁻³ , 10 ⁻⁴ , or none
Zero indication		Higher-digit zeros are suppressed
Over-range indication		'-19999' or '19999' blinking for display values out of the display range 'S.ERR' and 'Min' or 'Max' blinking when the input signal is out of the usable range
Alarm status indication	L indicator	Green turns on when the L alarm is tripped
	H indicator	Red turns on when the H alarm is tripped
	P indicator	Amber turns on when none of the other alarms is tripped Only 'P' turns on when no-alarm is selected with alarm setpoint
Function indicators		Zro, Spn, D/P, Tch, Fnc, Min, Max Display mode status and operation status, amber ON or blink

■ INPUT SPECIFICATIONS

DC current	47NLVT-Ax-R	Conformance range	4.00 – 20.00 mA DC
		Usable range	2.40 – 21.6 mA DC
		Input resistance	10 Ω
	47NLVT-Dx-R	Conformance range	0.00 – 20.00 mA DC
		Usable range	-2.00 – +22.00 mA DC
		Input resistance	10 Ω

DC voltage	47NLVT-4x-R	Conformance range	0.000 – 10.000 V DC
		Usable range	-1.000 – +11.000 V DC
		Input resistance	1 M Ω min.
	47NLVT-5x-R	Conformance range	0.000 – 5.000 V DC
		Usable range	-0.500 – +5.500 V DC
		Input resistance	1 M Ω min.
	47NLVT-6x-R	Conformance range	1.000 – 5.000 V DC
		Usable range	0.600 – 5.400 V DC
		Input resistance	1 M Ω min.
	47NLVT-4Wx-R	Conformance range	-10.000 – +10.000 V DC
		Usable range	-12.000 – +12.000 V DC
		Input resistance	1 M Ω min.
47NLVT-5Wx-R	Conformance range	-5.000 – +5.000 V DC	
	Usable range	-6.000 – +6.000 V DC	
	Input resistance	1 M Ω min.	

■ OUTPUT SPECIFICATIONS

Alarm output		Photo MOSFET relay
	Rating	26.4 V DC @ 100 mA (resistive load)
	ON resistance	$\leq 5 \Omega$

■ INSTALLATION

Power consumption	DC power	24 V DC	Operational voltage range 24 V DC \pm 10% Ripple 10% p-p max. 0.7 W max.
Operating temperature		-10 to +55°C (14 to 131°F)	
Operating humidity		10 to 90% RH (non-condensing)	
Mounting		Screw mounting	
Weight		120 g (0.26 lb)	

■ PERFORMANCE

Accuracy	$\pm 0.1\% \pm 1$ digit
Temp. coefficient	$\pm 0.015\%/^{\circ}\text{C}$ ($\pm 0.008\%/^{\circ}\text{F}$)
Response time	≤ 0.5 sec. (alarm output: 0 – 100% at 90% setpoint)
Line voltage effect	$\pm 0.1\%$ over voltage range
Insulation resistance	≥ 100 M Ω with 500 V DC
Dielectric strength	1500 V AC @ 1 minute (input to alarm output to power to ground)

■ STANDARDS & APPROVALS

EU conformity	EMC Directive EMI EN 61000-6-4 EMS EN 61000-6-2 RoHS Directive
---------------	---

16.2 MODEL NUMBERING

Code number: **47NLVT-[1][2]-R[3]**

[1] INPUT

Current

A: 4 – 20 mA DC (input resistance 10 Ω)

D: 0 – 20 mA DC (input resistance 10 Ω)

Voltage

4: 0 – 10 V DC (input resistance 1 M Ω min.)

5: 0 – 5 V DC (input resistance 1 M Ω min.)

6: 1 – 5 V DC (input resistance 1 M Ω min.)

4W: -10 – +10 V DC (input resistance 1 M Ω min.)

5W: -5 – +5 V DC (input resistance 1 M Ω min.)

[2] DISPLAY COLOR

R: Red

YR: Orange

G: Green

B: Blue

W: White

POWER INPUT

DC Power

R: 24 V DC (operational voltage range 24 V \pm 10%, ripple 10% p-p max.)

[3] OPTIONS

Blank: None

/Q: With options (specify the specification)

■ SPECIFICATIONS OF OPTION: Q

EX-FACTORY SETTING

/SET: Preset according to the Ordering Information Sheet (No. ESU-9562)

16.3 PARAMETER LIST

MODE	PARAMETER	SETTING RANGE	INDICATOR	DISPLAY	DEFAULT VALUE	DECIMAL POINT POSITION	UNIT
Measuring	Present value	-19999 – 19999	[H], [P], [L]	----	----	*1	User-defined
	MAX value	-19999 – 19999	[Max]	----	----	*1	User-defined
	MIN value	-19999 – 19999	[Min]	----	----	*1	User-defined
	Forced zero	-19999 – 19999	[Zro], [Fnc]	----	----	*1	User-defined
	L alarm setpoint	-19999 – 19999	[L]	----	----	*1	User-defined
	H alarm setpoint	-19999 – 19999	[H]	----	----	*1	User-defined
Scaling setting	Input scaling ZERO	A: 4.00 – 20.00	[Zro], [Tch]	[0400] to [2000]	[0400]	----	mA DC
		D: 0.00 – 20.00		[0000] to [2000]	[0000]		V DC
		4: 0.000 – 10.000		[0000] to [10000]	[0000]		
		5: 0.000 – 5.000		[0000] to [5000]	[0000]		
		6: 1.000 – 5.000		[1000] to [5000]	[1000]		
		4W: -10.000 – 10.000		[10000] to [10000]	[10000]		
		5W: -5.000 – 5.000		[-5000] to [5000]	[-5000]		
	Display scaling ZERO	-19999 – 19999	[Zro], [DIP]	[19999] to [19999]	A: [0400] D: [0000] 4: [0000] 5: [0000] 6: [1000] 4W: [10000] 5W: [-5000]	*1	User-defined
	Input scaling SPAN	A: 4.00 – 20.00	[Spn], [Tch]	[0400] to [2000]	[2000]	----	mA DC
		D: 0.00 – 20.00		[0000] to [2000]	[2000]		V DC
		4: 0.000 – 10.000		[0000] to [10000]	[10000]		
		5: 0.000 – 5.000		[0000] to [5000]	[5000]		
		6: 1.000 – 5.000		[1000] to [5000]	[5000]		
4W: -10.000 – 10.000			[10000] to [10000]	[10000]			
5W: -5.000 – 5.000		[-5000] to [5000]	[5000]				
Display scaling SPAN	-19999 – 19999	[Spn], [DIP]	[19999] to [19999]	A: [2000] D: [2000] 4: [10000] 5: [5000] 6: [5000] 4W: [10000] 5W: [5000]	*1	User-defined	

*1 Conforms to decimal point position setting.

NOTE 1: Indicators with the present value in Measuring Mode depend on the set alarm trip action.

NOTE 2: INDICATOR: [] = ON, [] = Blinking

NOTE 3: A, D, 4, 5, 6, 4W and 5W in the columns of SETTING RANGE and DEFAULT VALUE in Scaling Setting Mode and Alarm Setting Mode show input codes.

MODE	PARAMETER	SETTING RANGE	INDICATOR	DISPLAY	DEFAULT VALUE	DECIMAL POINT POSITION	UNIT
Scaling setting	Decimal point position	No decimal point, or 10 ⁻¹ to 10 ⁻⁴	[DP]	0000, 0000, 0000, 0000, 0000	A: 0000 D: 0000 4: 0000 5: 0000 6: 0000 4W: 0000 5W: 0000	----	----
	Teach calibration (ZERO)	----	[Zro], [Tch]	----	----	----	----
	Teach calibration (SPAN)	----	[Spn], [Tch]	----	----	----	----
Alarm setting	Alarm point	Dual alarm	[H], [L], [Fnc]	RLn2	RLn2	----	----
		No alarm	[P], [Fnc]	RLn0			
	L alarm setpoint	-19999 – 19999	[L], [Fnc]	19999 to 19999	A: 0500 D: 0200 4: 0000 5: 0500 6: 1400 4W: 8000 5W: 4000	*1	User-defined
	L trip action	High trip, low trip	[L], [Fnc]	LnHi, LnLo	LnLo	----	----
	L deadband (hysteresis)	0000 – 9999	[P], [L], [Fnc]	0000 to 9999	0000	----	User-defined
	L trip delay	00 – 99	[L], [DP], [Fnc]	00 to 99	00	----	Second
	L coil at alarm	Coil energized at alarm, de-energized at alarm	[L], [Fnc]	rYEn, rYdn	rYEn	----	----
	H alarm setpoint	-19999 – 19999	[H], [Fnc]	19999 to 19999	A: 1840 D: 1800 4: 9000 5: 4500 6: 4600 4W: 8000 5W: 4000	*1	User-defined
	H trip action	High trip, low trip	[H], [Fnc]	LnHi, LnLo	LnHi	----	----
	H deadband (hysteresis)	0000 – 9999	[H], [P], [Fnc]	0000 to 9999	0000	----	User-defined
	H trip delay	00 – 99	[H], [DP], [Fnc]	00 to 99	00	----	Second
	H coil at alarm	Coil energized at alarm, de-energized at alarm	[H], [Fnc]	rYEn, rYdn	rYEn	----	----
	Main display blinking at alarm	No blinking, blinking in 1.0, 0.5, 0.2, 0.1 sec. intervals	[Fnc]	b 0, b 1, b 2, b 3, b 4	b 0	----	Second

*1 Conforms to decimal point position setting.

NOTE 2: INDICATOR: = ON, = Blinking


NOTE 3: A, D, 4, 5, 6, 4W and 5W in the columns of SETTING RANGE and DEFAULT VALUE in Scaling Setting Mode and Alarm Setting Mode show input codes.

MODE	PARAMETER	SETTING RANGE	INDICATOR	DISPLAY	DEFAULT VALUE	DECIMAL POINT POSITION	UNIT								
Advanced setting	Moving average	None, 2, 4, 8, 16, 32, 64	[Fnc]	<table border="1"> <tr><td>RoFF</td><td>R 2</td></tr> <tr><td>R 4</td><td>R 8</td></tr> <tr><td>R 16</td><td>R 32</td></tr> <tr><td>R 64</td><td></td></tr> </table>	RoFF	R 2	R 4	R 8	R 16	R 32	R 64		R 4	----	Sample
	RoFF	R 2													
	R 4	R 8													
	R 16	R 32													
	R 64														
	Low-end cutout	OFF, ON	[Fnc]	SoFF, Son	SoFF	----	----								
	Low-end cutout value	000 – 999	[Zro], [Fnc]	000 to 999	000	----	User-defined								
	Brightness	1 (dark) to 5 (bright)	[DIP], [Fnc]	<table border="1"> <tr><td>1</td><td>2</td></tr> <tr><td>3</td><td>4</td></tr> <tr><td>5</td><td></td></tr> </table>	1	2	3	4	5		3	----	----		
1	2														
3	4														
5															
Setting time out	00 (setting time out disabled) 01 – 99	[DIP], [Fnc]	r 00 to r 99	r 60	----	Second									
Transition time to Lockout Setting Mode	00 – 99	[DIP], [Fnc]	P 00 to P 99	P 05	----	Second									
Display refreshing rate	00.0 – 99.9	[Fnc]	F000 to F999	F000	----	Second									
Version indication	----	[Fnc]	----	----	----	----									
Lockout setting	Alarm setting lockout	OFF, ON	[DIP], [Fnc]	RoFF, Ron	RoFF	----	----								
	Scaling setting lockout	OFF, ON	[DIP], [Fnc]	SoFF, Son	SoFF	----	----								
	Advanced setting lockout	OFF, ON	[DIP], [Fnc]	doFF, don	doFF	----	----								
	Forced zero lockout	OFF, ON	[DIP], [Fnc]	zoFF, zon	zon	----	----								
	Initialization	OFF, initialization	[DIP], [Fnc]	roFF, r5k	roFF	----	----								

NOTE 2: INDICATOR: = ON, = Blinking

16.4 PARAMETER MAP


16.4.1 OPERATION IN MEASURING MODE

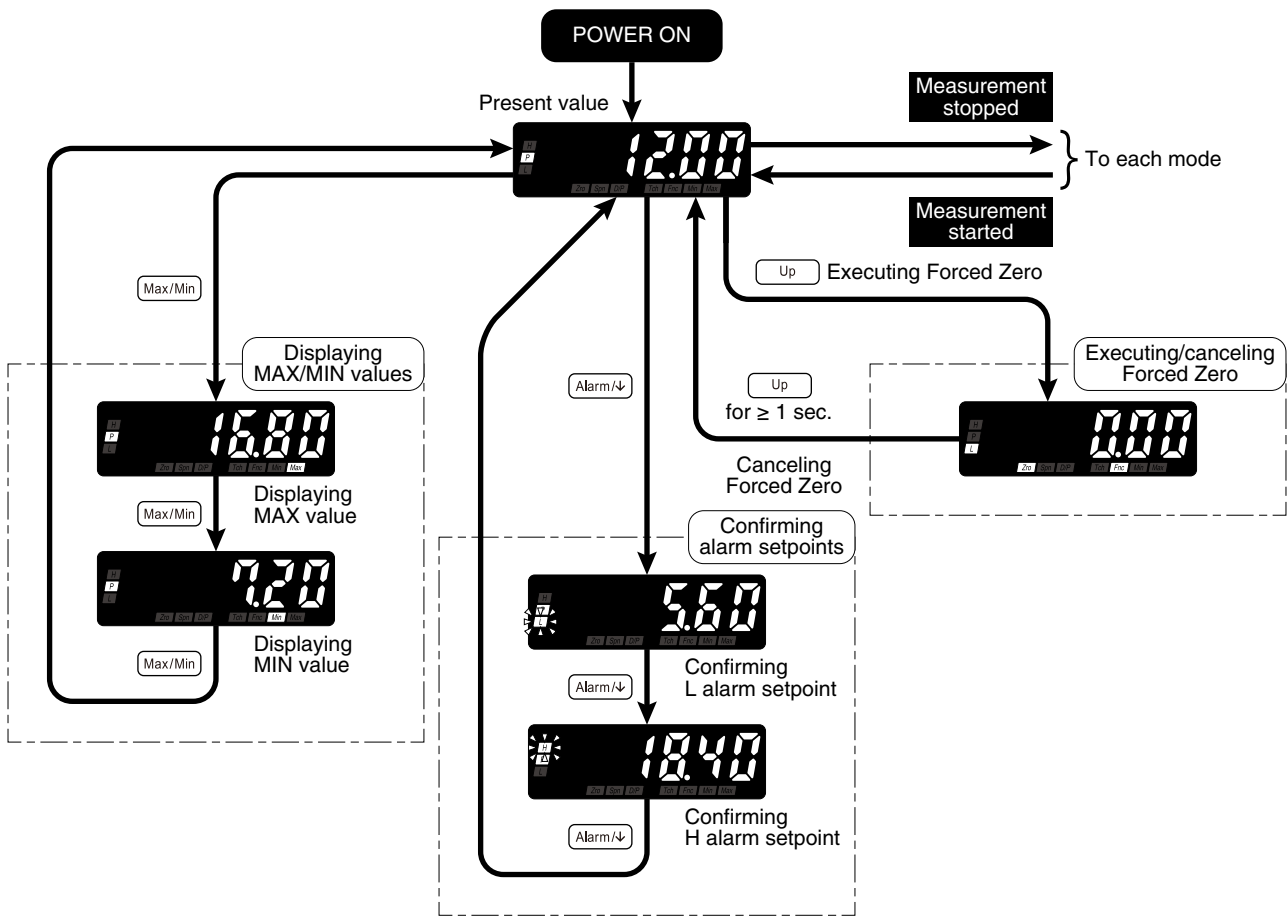

NOTE

- The display depends on the specifications, settings and input.
- When "No alarm" is selected for the alarm point parameter, alarm setpoints cannot be confirmed.
- Forced zero cannot be executed or canceled when the operation is disabled with the forced zero lockout setting.


16.4.2 SCALING SETTING MODE

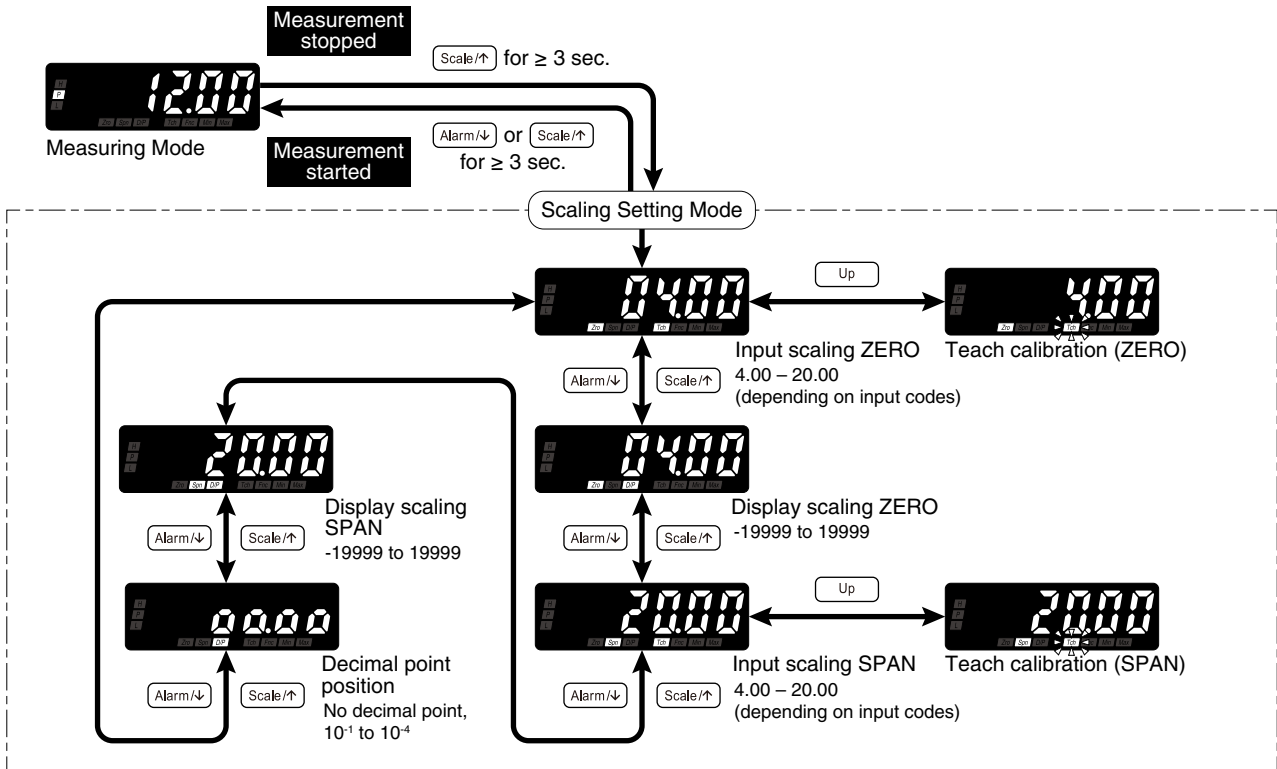

NOTE

The display depends on the specifications, settings and input.


16.4.3 ALARM SETTING MODE

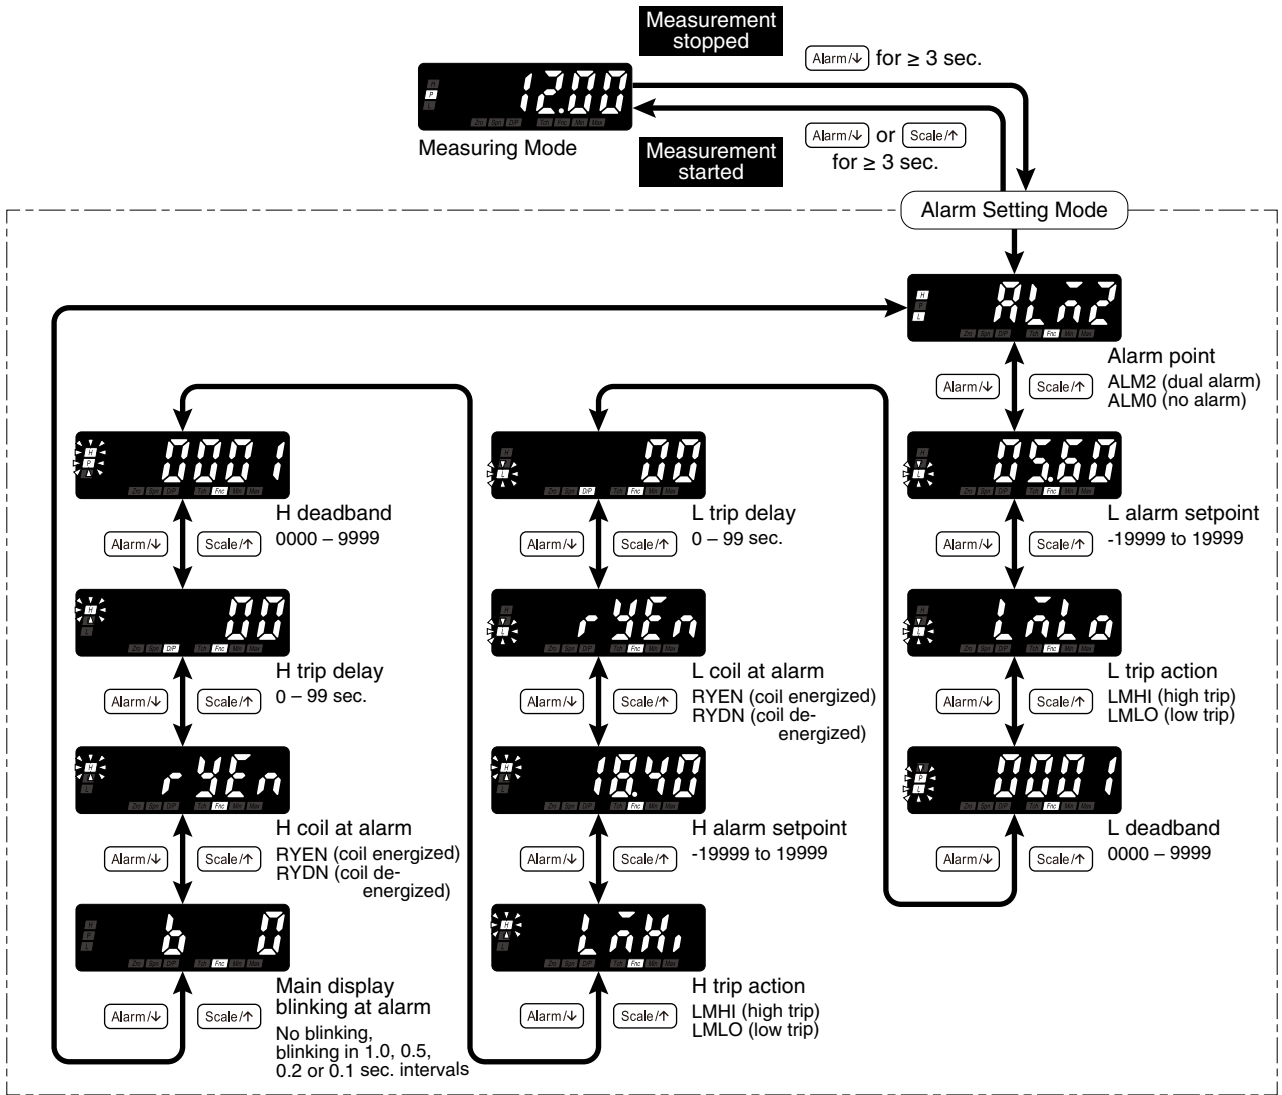

NOTE

- The display depends on the specifications, settings and input.
- Alarm Setting Mode is locked when “No alarm” is selected for the alarm point parameter.


16.4.4 ADVANCED SETTING MODE

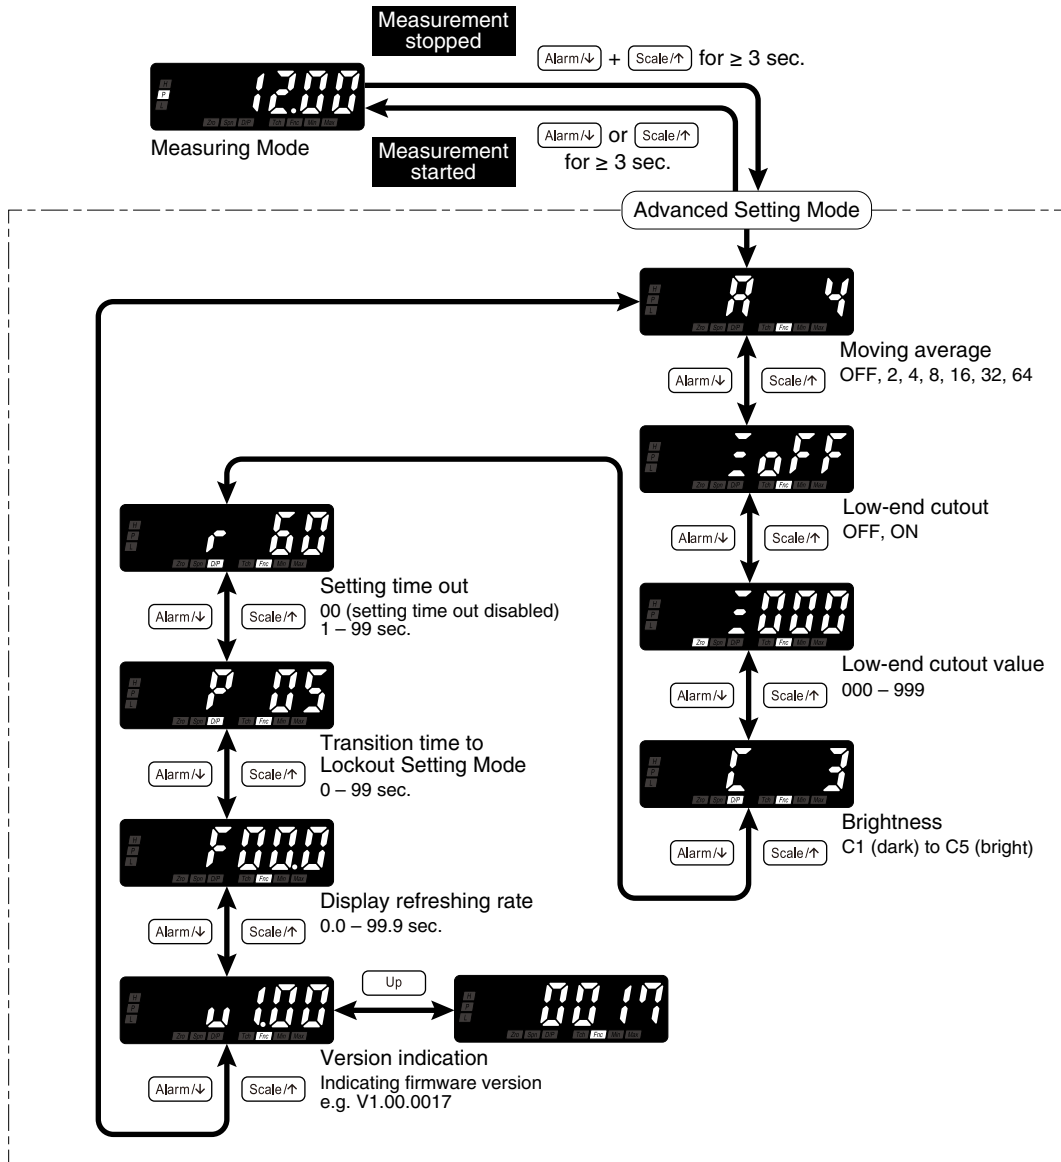

NOTE

- The display depends on the specifications, settings and input.
- With the low-end cutout set to OFF, the low-end cutout value setting is locked.
- Version indication is for indication only, not for setting.

16.4.5 LOCKOUT SETTING MODE

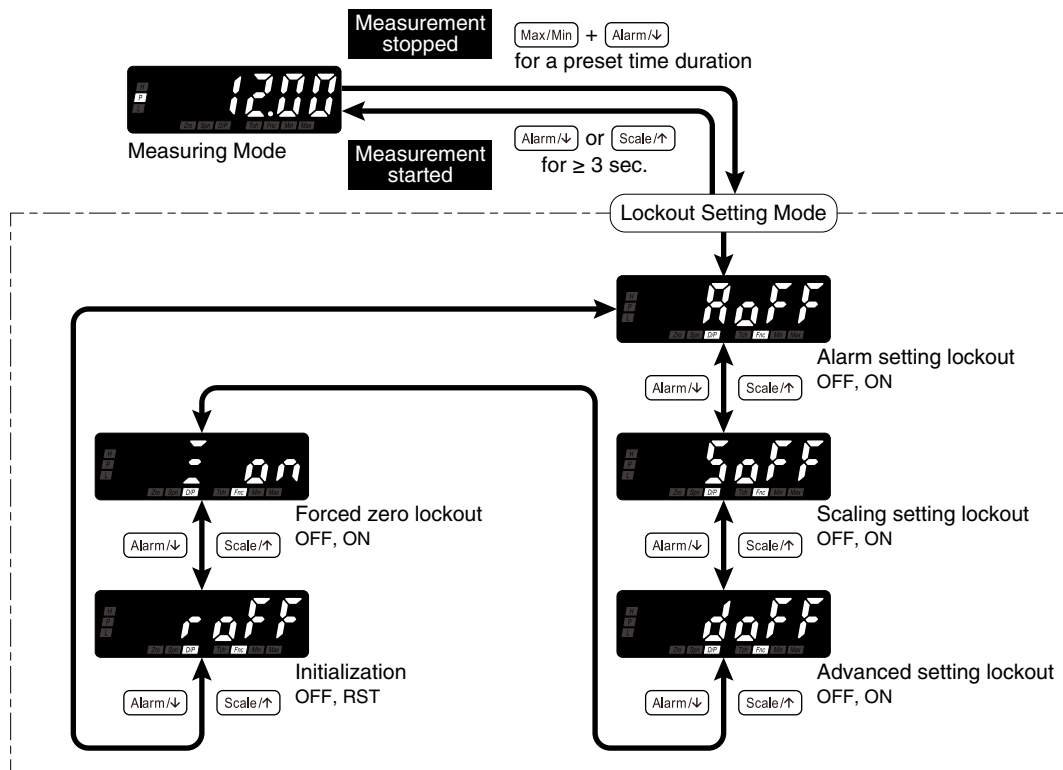













NOTE

The display depends on the specifications, settings and input.












 








16.5 CHARACTER SET

■ NUMERALS AND NEGATIVE SIGN

0	1	2	3	4	5	6	7	8	9
									
-	-1*1								
									

*1 Indication when the fifth digit is '-1'.

■ ALPHABET

A	B	C	D	E	F	G	H	I	J
									
K	L	M	N	O	P	Q	R	S	T
									
U	V	W	X	Y	Z				
